

**LEVEL II**

①  
BS

**GRAND CHARITON RIVER BASIN**

AD A104608

NEW CAMBRIA LAKE DAM  
MACON COUNTY, MISSOURI  
MO. 10387

**DTIC**  
**ELECTE**  
**S** **D**  
SEP 28 1981  
**E**

**PHASE I INSPECTION REPORT**  
**NATIONAL DAM SAFETY PROGRAM**



**United States Army**  
**Corps of Engineers**  
...Serving the Army  
...Serving the Nation

**St. Louis District**

THIS DOCUMENT IS BEST QUALITY PRACTICABLE.  
THE COPY FURNISHED TO DDC CONTAINED A  
SIGNIFICANT NUMBER OF PAGES WHICH DO NOT  
REPRODUCE LEGIBLY.

PREPARED BY: U. S. ARMY ENGINEER DISTRICT, ST. LOUIS

FOR: STATE OF MISSOURI

This document has been approved  
for public release and sale in  
distribution is unlimited.

DECEMBER 1979

81 9 28 115

FILE COPY

## **DISCLAIMER NOTICE**

**THIS DOCUMENT IS BEST QUALITY  
PRACTICABLE. THE COPY FURNISHED  
TO DTIC CONTAINED A SIGNIFICANT  
NUMBER OF PAGES WHICH DO NOT  
REPRODUCE LEGIBLY.**

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
	AD-A104 608	
4. TITLE (and Subtitle) Phase I Dam Inspection Report National Dam Safety Program New Cambria Lake Dam (MO 10387) Macon County, Missouri		5. TYPE OF REPORT & PERIOD COVERED Final Report
7. AUTHOR(s) Consoer, Townsend and Associates, Ltd.		6. PERFORMING ORG. REPORT NUMBER
9. PERFORMING ORGANIZATION NAME AND ADDRESS U.S. Army Engineer District, St. Louis Dam Inventory and Inspection Section, LMSED-PD 210 Tucker Blvd., North, St. Louis, Mo. 63101		8. CONTRACT OR GRANT NUMBER(s) DACW43-79-C-0075
11. CONTROLLING OFFICE NAME AND ADDRESS U.S. Army Engineer District, St. Louis Dam Inventory and Inspection Section, LMSED-PD 210 Tucker Blvd., North, St. Louis, Mo. 63101		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)		12. REPORT DATE December 1979
		13. NUMBER OF PAGES Approximately 70
		15. SECURITY CLASS. (of this report)  UNCLASSIFIED
16. DISTRIBUTION STATEMENT (of this Report)  Approved for release; distribution unlimited.  Walter G. Shiffrin		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)  National Dam Safety Program. New Cambria Lake Dam (MO 10387), Grand-Chariton River Basin, Macon County, Missouri. Phase I Inspection Report.		
18. SUPPLEMENTARY NOTES		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number)  Dam Safety, Lake, Dam Inspection, Private Dams		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number)  This report was prepared under the National Program of Inspection of Non-Federal Dams. This report assesses the general condition of the dam with respect to safety, based on available data and on visual inspection, to determine if the dam poses hazards to human life or property.		

DD FORM 1 JAN 73 1473

EDITION OF 1 NOV 65 IS OBSOLETE

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

412553



DEPARTMENT OF THE ARMY  
ST. LOUIS DISTRICT, CORPS OF ENGINEERS  
210 NORTH 12TH STREET  
ST. LOUIS, MISSOURI 63101

IN REPLY REFER TO

SUBJECT: New Cambria Lake Dam Phase I Inspection Report

This report presents the results of field inspection and evaluation of the New Cambria Lake Dam (Mo. 10387).

It was prepared under the National Program of Inspection of Non-Federal Dams.

This dam has been classified as unsafe, non-emergency by the St. Louis District as a result of the application of the following criteria:

- 1) Spillway will not pass 50 percent of the Probable Maximum Flood
- 2) Overtopping could result in dam failure
- 3) Dam failure significantly increases the hazard to loss of life downstream

SUBMITTED BY:

SIGNED

24 MAR 1980

Chief, Engineering Division

Date

APPROVED BY:

SIGNED

24 MAR 1980

Colonel, CE, District Engineer

Date

Accession For	
NTIS GRA&I	<input checked="" type="checkbox"/>
DTIC TAB	<input type="checkbox"/>
Unannounced	<input type="checkbox"/>
Justification	
By _____	
Distribution/	
Availability Codes	
Dist	Avail and/or Special
A	23

NEW CAMBRIA LAKE DAM  
MACON COUNTY, MISSOURI

MISSOURI INVENTORY NO. 10387

PHASE I INSPECTION REPORT  
NATIONAL DAM SAFETY PROGRAM

PREPARED BY  
CONSOER, TOWNSEND AND ASSOCIATES, LTD.  
ST. LOUIS, MISSOURI  
AND  
ENGINEERING CONSULTANTS, INC.  
ENGLEWOOD, COLORADO  
A JOINT VENTURE

UNDER DIRECTION OF  
ST. LOUIS DISTRICT, CORPS OF ENGINEERS  
FOR  
GOVERNOR OF MISSOURI

DECEMBER 1979

PHASE I INSPECTION REPORT  
NATIONAL DAM SAFETY PROGRAM

Name of Dam: New Cambria Lake Dam, Missouri Inv. No. 10387  
State Located: Missouri  
County Located: Macon  
Stream: An unnamed tributary of Old Channel  
Date of Inspection: August 23, 1979

Assessment of General Condition

New Cambria Lake Dam was inspected by the engineering firms of Consoer, Townsend and Associates, Ltd. and Engineering Consultants, Inc. (A Joint Venture) of St. Louis, Missouri according to the "Recommended Guidelines for Safety Inspection of Dams". These guidelines were developed by the Chief of Engineers, U.S. Army, Washington, D.C., with the help of Federal and State agencies, professional engineering organizations, and private engineers. The resulting guidelines are considered to represent a consensus of the engineering profession.

Based on the criteria in the guidelines, the dam is in the high hazard potential classification, which means that loss of life and appreciable property loss could occur in the event of failure of the dam. The estimated damage zone extends approximately three and one-half miles downstream of the dam. Within the damage zone are eight dwellings, three buildings, one quarry and two crossings of U.S. Highway 36, which may be subjected to flood-

ing, with possible damage and/or destruction, and possible loss of life. New Cambria Lake Dam is in the small size classification since it is less than 40 feet high and impound less than 1,000 acre-feet of water.

Our inspection and evaluation indicates that the spillway of New Cambria Lake Dam does not meet the criteria set forth in the guidelines for a dam having the above size and hazard potential. New Cambria Lake Dam being a small size dam with a high hazard potential, is required by the guidelines to pass from one-half of the Probable Maximum Flood to the Probable Maximum Flood without overtopping. Considering the volume of water impounded, the relatively narrow valley, the large number of dwellings and the two crossings of a major highway downstream of the dam, the Probable Maximum Flood is considered the appropriate spillway design flood. It was determined that the reservoir/spillway system can accommodate 30 percent of the Probable Maximum Flood without overtopping the dam. Our evaluation also indicates that the reservoir/spillway system can accommodate the 100-year flood without overtopping.

The Probable Maximum Flood is defined as the flood discharge that may be expected from the most severe combination of critical meteorological and hydrologic conditions that are reasonably possible in the region. The 100-year flood is defined as a flood having a one percent chance of being equalled or exceeded during any given year.

Other deficiencies noted by the inspection team were: a large tree growing on the upstream slope; the heavy vegetative growth on both the upstream and downstream embankment slopes; the undermining of the downstream end of the spillway chute; lack of trashrack on the spillway; heavy growth of trees and vegetation on the downstream channel; minor wave erosion on the upstream embankment slope; rodent activities on the embankment; a need for per-


iodic inspection by a qualified engineer and a lack of maintenance schedule. The lack of seepage and stability analyses on record is also a deficiency that should be corrected.

It is recommended that the owner take action to correct or control the deficiencies described above.

*Walter G. Shifrin*  
Walter G. Shifrin, P.E.





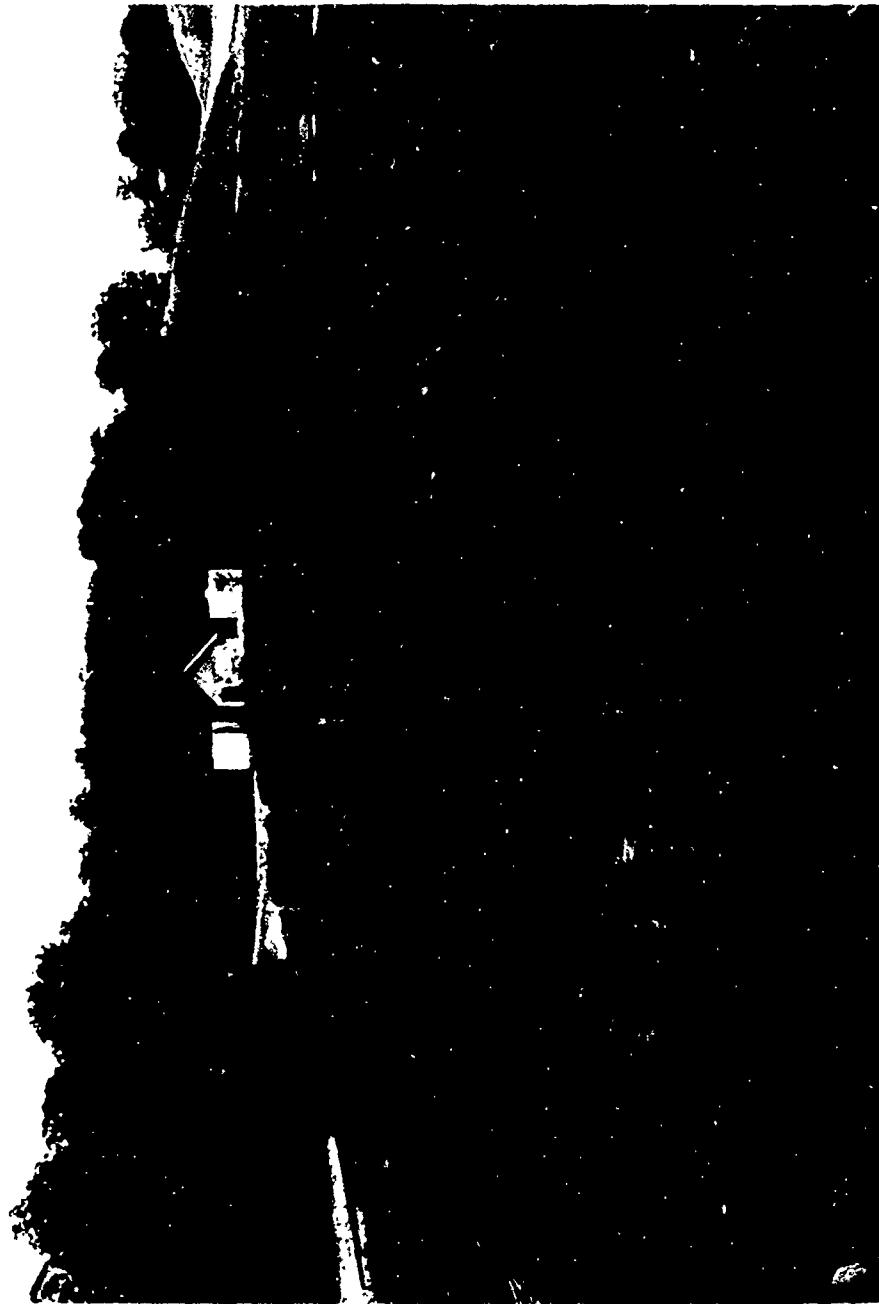

Overview of New Cambria Lake Dam

PHASE I INSPECTION REPORT  
NATIONAL DAM SAFETY PROGRAM

NEW CAMBRIA LAKE DAM, I.D. No. 10387

TABLE OF CONTENTS

<u>Sect. No.</u>	<u>Title</u>	<u>Page</u>
SECTION 1	PROJECT INFORMATION . . . . .	1
	1.1 General . . . . .	1
	1.2 Description of Project . . . . .	3
	1.3 Pertinent Data . . . . .	6
SECTION 2	ENGINEERING DATA . . . . .	8
	2.1 Design . . . . .	8
	2.2 Construction . . . . .	8
	2.3 Operation . . . . .	8
	2.4 Evaluation . . . . .	8
SECTION 3	VISUAL INSPECTION . . . . .	10
	3.1 Findings . . . . .	10
	3.2 Evaluation . . . . .	14

## TABLE OF CONTENTS

(Continued)

<u>Sect. No.</u>	<u>Title</u>	<u>Page</u>
SECTION 4	OPERATION PROCEDURES . . . . .	16
	4.1 Procedures . . . . .	16
	4.2 Maintenance of Dam . . . . .	16
	4.3 Maintenance of Operating Facilities . . . . .	16
	4.4 Description of Any Warning System in Effect . . . . .	17
	4.5 Evaluation . . . . .	17
SECTION 5	HYDRAULIC/HYDROLOGIC . . . . .	18
	5.1 Evaluation of Features . . . . .	18
SECTION 6	STRUCTURAL STABILITY. . . . .	22
	6.1 Evaluation of Structural Stability. . . . .	22
SECTION 7	ASSESSMENT/REMEDIAL MEASURES. . . . .	24
	7.1 Dam Assessment . . . . .	24
	7.2 Remedial Measures. . . . .	26

TABLE OF CONTENTS

(Continued)

LIST OF PLATES

	<u>Plate No.</u>
LOCATION MAP . . . . .	1
PLAN, ELEVATION AND SECTION OF DAM . . . . .	2
GEOLOGIC MAP . . . . .	3
SEISMIC ZONE MAP . . . . .	4

APPENDICES

APPENDIX A	-	PHOTOGRAPHS
APPENDIX B	-	HYDROLOGIC COMPUTATIONS

PHASE I INSPECTION REPORT  
NATIONAL DAM SAFETY PROGRAM

NEW CAMBRIA LAKE DAM, Missouri Inv. No. 10387

SECTION 1: PROJECT INFORMATION

1.1 General

a. Authority

The Dam Inspection Act, Public Law 92-367 of August, 1972, authorizes the Secretary of the Army, through the Corps of Engineers, to initiate a national program of dam inspections. Inspection for New Cambria Lake Dam was carried out under Contract DACW 43-79-C-0075 between the Department of the Army, St. Louis District, Corps of Engineers, and the engineering firms of Consoer, Townsend & Associates, Ltd., and Engineering Consultants, Inc. (A Joint Venture), of St. Louis, Missouri.

b. Purpose of Inspection

The visual inspection of New Cambria Lake Dam was made on August 23, 1979. The purpose of the inspection was to make a general assessment as to the structural integrity and operational adequacy of the dam embankment and its appurtenant structures.

c. Scope of Report

This report summarizes available pertinent data relating to the project; presents a summary of visual observations made during the field inspection; presents an assessment of hydrologic and hydraulic conditions at the site; presents an assessment as to the structural adequacy of the various project features; and assesses the general condition of the dam with respect to safety.

Subsurface investigations, laboratory testing, and detailed analyses were not within the scope of this study. The conclusions drawn herein, therefore, are based on the presence of, or absence of, obvious signs of distress. No warranty as to the absolute safety of the project features is implied by the conclusions presented in this report.

It should be noted that reference in this report to left or right abutments is as viewed looking downstream. Where left abutment or left side of the dam is used in this report, this also refers to the east abutment or side, and right to the west abutment or side.

d. Evaluation Criteria

Criteria used to evaluate the dam were furnished by the Department of the Army, Office of the Chief of Engineers, in the publication "Recommended Guidelines for Safety Inspection of Dams", Appendix D. These guidelines were developed with the help of several Federal agencies and many State agencies, professional engineering organizations, and private engineers.

## 1.2

### Description of the Project

#### a. Description of Dam and Appurtenances

It should be noted that design drawings were not available for the dam or appurtenant structures. The following description is based exclusively on observations and measurements made during the visual inspection.

The dam is an earthfill structure between earth abutments. The crest width is 18 feet and the crest length is 412 feet. The crest elevation is 743.6 feet above M.S.L. Embankment slopes were measured as 1V to 3H. The upstream slope was measured from the reservoir water surface to the crest. The maximum height of the embankment is 21 feet.

The spillway for the New Cambria Lake Dam is a cut into the right abutment. The spillway is a concrete lined, uncontrolled open chute with vertical rock masonry side walls. The bottom width of the control section is 12.75 feet. The total length of the spillway chute is approximately 141 feet.

A regulated outlet pipe is provided for the dam. The outlet pipe is used as a water supply line. The water supply system consists of a centrifugal pump located on the crest of the dam 200 feet to the right of the left abutment. The intake to the pump is a 2-inch C.I.P. and the discharge line is a 2.5-inch C.I.P. The discharge line goes to a small water treatment plant located on the left abutment. The pump is housed in a concrete block pit.

No low level drain was provided for the dam.

b. Location

The New Cambria Lake Dam is located on an unnamed tributary to the Old Channel in Macon County, Missouri. The community of New Cambria is approximately one mile to the west of the dam. The dam and lake are located in Section 7, Township 57 North, Range 16 West on the Elmer Quadrangle Sheet (15 minute series).

c. Size Classification

According to the "Recommended Guidelines for Safety Inspection of Dams", by the U.S. Department of the Army, Office of the Chief Engineer, the dam is classified in the dam size category as being "Small" since its storage is less than 1,000 acre-feet. The dam is also classified as "Small" in dam size category because its height is less than 40 feet. The overall size classification is, accordingly, "Small" in size.

d. Hazard Classification

The dam has been classified as having "High" hazard potential in the National Inventory of Dams, on the basis that in the event of failure of the dam or its appurtenances, excessive damage could occur to downstream property, together with the possibility of the loss of life. Our findings concur with the classification. The estimated damage zone extends approximately 3.5 miles downstream of the dam. Within the damage zone are eight dwellings, three buildings, one quarry and two crossings of U.S. Highway 36.



e. Ownership

The New Cambria Lake Dam is owned by the City of New Cambria. The mailing address is New Cambria City Hall, c/o Morris Avelin, Water Superintendent, New Cambria, Missouri, 63558.

f. Purpose of Dam

The main purpose of the dam is to impound water for domestic water supply and recreational use.

g. Design and Construction History

New Cambria Lake Dam was designed and built as a W.P.A. project with a completion date of 1936. The Contractor is listed as the Federal Government and, according to Mr. Dave Hoffman, Dept. of Natural Resources, Rolla, Missouri, and Mrs. Morris Avelyn, wife of Water Superintendent, New Cambria, Missouri, the dam was most likely built by local residents. It is not known who the original design engineer was.

h. Normal Operational Procedures

Normal procedure is to allow the reservoir to remain as full as possible. New Cambria Lake is used primarily for water supply and also for recreational purposes for the residents of New Cambria, Missouri. The water level below the spillway crest is controlled by rainfall, runoff and evaporation.

1.3 Pertinent Data

a. Drainage Area (square miles): 0.18

b. Discharge at Damsite

Estimated experienced maximum flood (cfs): NA

Estimated ungated spillway capacity with reservoir  
at top of dam elevation (cfs): 229

c. Elevation (feet above MSL)

Top of dam: 743.6

Spillway crest: 740.0 (assumed)

Normal Pool: 740.0

Maximum Pool (PMF): 744.62

d. Reservoir

Length of pool with water surface at top  
of dam elevation (feet): 1,500

e. Storage (Acre-Feet)

Top of dam: 70

Spillway crest: 40

Normal Pool: 40

Maximum Pool (PMF): 90

f. Reservoir Surface (Acres)

Top of dam: 10

Spillway crest: 7

Normal Pool: 7

Maximum Pool (PMF): 11.5

g. Dam

Type: Earthfill

Length: 412 feet

Structural Height: 21 feet

Hydraulic Height:	21 feet
Top width:	18 feet
Side slopes:	
Downstream	1V to 3H
Upstream	1V to 3H (crest to water surface)
Zoning:	Unknown
Impervious core:	Unknown
Cutoff:	Unknown
Grout curtain:	Unknown

h. Diversion and Regulating Tunnel	None
------------------------------------	------

i. Spillway

Type:	Concrete lined chute, uncontrolled
Length of weir:	12.75 feet
Crest Elevation (feet above MSL):	740.0 (assumed)

j. Regulating Outlets

Type:	Water supply system
Length:	Unknown
Closure:	Centrifugal Pump
Maximum Capacity:	Unknown

## SECTION 2 : ENGINEERING DATA

### 2.1 Design

Design drawings are not available for the dam and appurtenant structures.

### 2.2 Construction

No records or construction data are available for New Cambria Lake Dam.

### 2.3 Operation

No operational data are available for the lake and dam.

### 2.4 Evaluation

#### a. Availability

No design drawings, design computations, construction data, or operation data are available.

In addition, no pertinent data was available for review of hydrology, spillway capacity, flood routing through the reservoir, slope stability, seepage analysis, or foundation conditions.

#### b. Adequacy

The lack of engineering data did not allow for a definitive review and evaluation. Therefore, the adequacy of this dam could not be assessed from the standpoint of reviewing and evaluation design, operation and construction data,

but is based primarily on visual inspection, past performance history, and sound engineering judgment.

Seepage and stability analyses comparable to the requirements of the "Recommended Guidelines for Safety Inspection of Dams" were not available, which is considered a deficiency. These seepage and stability analyses should be performed for appropriate loading conditions and made a matter of record.

c. Validity

No valid engineering data are available.

### SECTION 3: VISUAL INSPECTION

#### 3.1 Findings

##### a. General

A visual inspection of the New Cambria Lake Dam was made on August 23, 1979. The dam generally is in poor condition. The following persons were present during the inspection:

<u>Name</u>	<u>Affiliation</u>	<u>Disciplines</u>
Dr. M.A. Samad	Engineering Consultants, Inc.	Project Engineer, Hydraulics and Hydrology
Mark R. Haynes	Engineering Consultants, Inc.	Civil, Structural and Mechanical
Dawn L. Jacoby	Engineering Consultants, Inc.	Soils
Peter L. Strauss	Engineering Consultants, Inc.	Geology
Kevin Blume	Consoer, Townsend & Assoc., Ltd.	Civil and Structural

Specific observations are discussed below.

b. Dam

The crest of the dam is protected against surface erosion by a cover of grass. The area adjacent to the spillway is covered by asphalt paving. One crack was observed on the dam crest near the left abutment. No significant deviations in horizontal or vertical alignment were apparent. A slight depression on the downstream side of the crest near the spillway appeared to be caused by vehicular traffic. There was no evidence of the dam ever being overtopped. Material taken from below the topsoil is a silty clay.

The upstream slope had riprap placed to approximately two feet above the water surface on the day of the inspection. The riprap is flat, slabby sandstone. In many areas, the sandstone has been broken down significantly so that protection from wave action is no longer provided. Minor erosion was observed in these areas. The upper section of the slope is covered with grass and bushes. One large tree was growing on the slope. No depressions or settlement were apparent on the slope. No cracks were observed. There was evidence of rodent activity on the embankment.

The downstream slope is overgrown by tall, dense vegetation. No bulges or depressions were apparent. The slope appeared to have been burned off at one time. One large tree stump was observed at the toe. A large pile of rubble and trash is located near the crest. Areas of seepage could not be readily identified since the surface was moist from a rainfall the previous evening. No flowing seepage was observed.

c. Project Geology and Soils

According to the "Missouri General Soil Map and Soil Association Description," published by the Soil Conservation Service, the materials in the general area of the dam belong to the soil series of Weller-Keswick-Lindley-Mandeville in the Central Mississippi Valley Wooded Slopes forest. The soils basically are formed from loess, glacial till and weathered shale. The permeability of these soils range from slow to moderate. The Lindley soils generally are quite erodable and would be particularly susceptible to erosion due to overtopping.

The left abutment slopes gently upward from the crest. An erosion channel approximately 3 inches wide was observed along the access road along the left abutment contact area. The right abutment slopes upward from the crest at approximately 1V to 1H. No signs of instability were apparent.

The damsite is physiographically located in the Dissected Till Plains Section of the Central Lowlands Physiographic Province, according to Nevin Fennerman's "Physiography of the Eastern United States." This section is distinguished from the Young Drift section on the north and from the Till Plains on the east by the stage it has reached in the post-glacial erosion cycle. Broadly generalized, this section is a nearly flat till plain, submature to mature in its erosion cycle.

No faults have been identified in the vicinity of the dam.

Some minor folding has been identified in Macon County. The dam site lies about three miles to the southwest of the trace of the Macon-Sullivan Trough and about six miles to the northeast of the College Mound-Bucklin Anticline. The



Macon-Sullivan Trough had its last movement in post-Ordovician and the College Mount Bucklin Anticline had its last movement in late or post-Pennsylvanian. These minor structures have no effect on the dam.

The site bedrock geology, beneath the drift, as shown on the Geologic Map of Missouri, (1979) is interbedded Pennsylvanian age shales, limestones, and sandstones. These strata generally strike north-south and dip gently to the west.

No bedrock was seen at or in the vicinity of the damsite. The entire area is mantled by glacial drift.

#### d. Appurtenant Structures

##### (1) Spillway

The overall condition of the spillway chute appeared to be good. Minor spalling and minor temperature cracks were observed in the concrete lining of the spillway. The rock masonry side walls of the spillway appeared to be stable. The downstream end of the chute is starting to be undermined by discharges through the spillway. No trashrack for the spillway was provided, however, remnants of one was observed. The spillway was not obstructed. No instability was observed in the spillway.

Two pieces of a concrete slab were observed upstream of the spillway. They appear to have been the original weir section for the spillway.

## (2) Outlet Works

The intake to the water supply line was inaccessible on the day of the inspection. The pump on the crest of the dam is operable. It is assumed that the entire water supply system is operable.

### e. Reservoir Area

The water surface elevation was approximately 738.7 feet above M.S.L. on the day of the inspection.

The reservoir rim is gently sloped. No indication of instability or severe erosion was observed. The slopes above the reservoir are heavily grassed and wooded. No buildings or dwellings were observed around the reservoir rim. A pumphouse and water treatment plant are located on the left abutment.

### f. Downstream Channel

The downstream channel is well defined and 25-feet wide and 3-feet deep for approximately 150 feet from the downstream end of the discharge channel to a concrete box culvert which passes under U.S. Highway 36. The channel is straight in alignment between the two points. The channel is obstructed by a heavy growth of vegetation and trees. The box culvert under U.S. Highway 36 is 6 feet wide and 5 feet high.

## 3.2 Evaluation

The visual inspection did not reveal any items which are sufficiently significant to indicate a need for immediate remedial action.

The following conditions were observed which could affect the safety of the dam or which will require maintenance within a reasonable period of time.

1. The tree and heavy vegetation growth observed on the upstream and downstream slopes should be removed from the slopes and an adequate protective grass cover retained on the slopes. The roots of the trees present possible paths for piping through the embankment. The root systems can also do damage from being uprooted by a storm. Therefore, the trees should be removed from the embankment under the guidance of an engineer experienced in the design and construction of earthen dams.

2. The existence of burrowing animals on the embankment could jeopardize the safety of the dam. The holes created by the animals make avenues for possible piping. The extent of damage to the embankment done by the burrowing animals should be determined and corrective measures undertaken as required.

3. No trashrack is provided for the spillway. A trashrack should be provided for and maintained for the spillway in order to prevent blockage of the spillway by debris.

## SECTION 4: OPERATIONAL PROCEDURES

### 4.1 Procedures

New Cambria Lake Dam is used for water supply purposes. A small pump pit is situated at the mid section of the dam. The pump is operated periodically to fill the storage tanks at the treatment plant located near the left abutment of the dam.

### 4.2 Maintenance of Dam

The dam and appurtenant structures are maintained by the water superintendent, Mr. Morris Avelin, and city maintenance crews. There is an abundance of vegetation covering the upstream and downstream slopes of the dam. The crest is mowed periodically.

There is at this time, no trash rack for the spillway and some areas of spalling and cracking in the spillway slab were observed.

### 4.3 Maintenance of Operating Facilities

As mentioned in Section 4.2, the operating facilities at the damsite are maintained by the Water Superintendent, Morris Avelin and city maintenance crews. The pump pit which is situated at the mid section of the dam is in poor condition. Electrical connections to the pump motor are exposed and there is an inch or so of standing water in the pit. It appears that the water supply facilities located adjacent to the dam receive moderate attention.

4.4 Description of Any Warning System in Effect

The inspection team is not aware of any warning system in effect.

4.5 Evaluation

The crest of the dam is apparently the only area on the dam maintained. The vegetation growing on both the upstream and downstream slopes should be controlled. These, and other items listed in Section 7.2 should be corrected within a reasonable period of time.

## SECTION 5: HYDRAULIC/HYDROLOGIC

### 5.1 Evaluation of Features

#### a. Design

The watershed area of New Cambria Lake Dam upstream from the dam axis consists of approximately 117 acres. Most of the watershed area is wooded and covered with grass. Land gradients in the watershed average roughly 14 percent. New Cambria Lake Dam is located on an intermittent stream which joins Old Channel, a tributary of the Chariton River. The reservoir is about one mile upstream from the confluence of the intermittent stream and Old Channel. At its longest arm the watershed is approximately 1/2 mile long. A drainage map showing the watershed area is presented as Plate 1 in Appendix B.

Evaluation of the hydraulic and hydrologic features of New Cambria Lake Dam was based on criteria set forth in the Corps of Engineers' "Recommended Guidelines for Safety Inspection of Dams", and additional guidance provided by the St. Louis District of the Corps of Engineers. The Probable Maximum Flood (PMF) was calculated from the Probable Maximum Precipitation using the methods outlined in the U.S. Weather Bureau Publication, Hydrometeorological Report No. 33. The probable maximum storm duration was set at 24 hours, and storm rainfall distribution was based on criteria given in the Corps of Engineers' EM 1110-2-1411 (Standard Project Storm). The Soil Conservation Service (SCS) method was used for deriving the unit hydrograph, utilizing the Corps of Engineers' computer program HEC-1 (Dam Safety Version). The parameters of

the unit hydrograph are presented in Appendix B. The SCS method was used for determining the loss rate. The hydrologic soil group of the watershed was determined by use of published soil maps. The hydrologic soil group of the watershed and the SCS curve number are also presented in Appendix B. The curve number, the unit hydrograph parameters, and the PMP rainfall were directly input to the HEC-1 (Dam Safety Version) computer program to obtain the PMF hydrograph. The computed peak discharges of the PMF and one-half of the PMF at New Cambria Lake Dam were routed through New Cambria Lake Dam reservoir by the Modified Puls Method also utilizing the HEC-1 (Dam Safety Version) computer program. The peak discharges for the PMF and one-half of the PMF at New Cambria Lake Dam are 2,403 cfs and 1,201 cfs respectively.

Both the PMF and one-half of the PMF inflow hydrographs at New Cambria Lake Dam were routed through New Cambria Lake Dam reservoir by the Modified Puls Method, also utilizing the HEC-1 (Dam Safety Version) computer program. The peak outflow discharges for the PMF and one-half of the PMF at New Cambria Lake Dam are 1,961 and 785 cfs, respectively. Both the PMF and one-half of the PMF when routed through the reservoir resulted in overtopping of New Cambria Lake Dam.

The size of physical features utilized to develop the stage-outflow relation for the spillway and overtopping of the dam were determined from field notes, and sketches, prepared during the field inspection. The reservoir stage-capacity data were based on the U.S.G.S. Elmer Quadrangle topographic map (15 minute series). The spillway and dam overtop rating curve and the reservoir capacity curve for New Cambria Lake Dam are presented as Plates 2 and 3 in Appendix B.

From the standpoint of dam safety, the hydrologic design of a dam must aim at avoiding overtopping. Overtopping is especially dangerous for an earth dam because of its erosive characteristics. The safe hydrologic design of an embankment dam requires a spillway discharge capability in combination with an embankment crest height that can handle a very large and exceedingly rare flood without overtopping.

The Corps of Engineers design dams to safely pass the Probable Maximum Flood that is estimated could be generated from the dam's watershed. This is the generally accepted criterion for major dams throughout the world, and is the standard for dam safety where overtopping would pose any threat to human life. Accordingly, the hydrologic requirement for safety for this dam is the capability to pass the Probable Maximum Flood without overtopping.

b. Experience Data

It is believed that no records of reservoir stage or spillway discharge are maintained for this site.

c. Visual Observations

Observations made of the spillway during the visual inspection are discussed in Section 3.1c(1) and evaluated in Section 3.2.

d. Overtopping Potential

As indicated in Section 5.1.a, both the Probable Maximum Flood and one-half of the Probable Maximum Flood, when routed through the reservoir, resulted in overtopping of the dam. The peak outflow discharges for the PMF and one-half of the PMF at New Cambria Lake Dam are 1,961 cfs and 785 cfs, respectively. The PMF overtopped the dam crest by 1.02 feet



and one-half of the PMF overtopped the dam crest by 0.50 feet. The total duration of embankment overflow is 4.67 hours during the PMF and 1.17 hours during one-half of the PMF. The spillway and the reservoir of New Cambria Lake Dam are capable of accommodating a flood equal to approximately 30 percent of the PMF before overtopping the dam. The reservoir/spillway system of New Cambria Lake Dam will accommodate the 100-year flood without overtopping.

The failure of the dam could cause extensive damage to the property downstream of the dam and possible loss of life. The estimated damage zone extends approximately 3.5 miles downstream of the dam. Within the damage zone are eight dwellings, three buildings, one quarry and two crossings of U.S. Highway 36.

## SECTION 6: STRUCTURAL STABILITY

### 6.1 Evaluation of Structural Stability

#### a. Visual Observations

There were no signs of significant settlement or distress observed on the embankment or foundation during the visual inspection. The upstream slope of the embankment is exhibiting minor erosion due to wave action. This condition does not appear serious at this time, but it should be monitored and the slope stabilized as required. The embankment appears to be adequately protected against surface erosion. There were no indications of past or present slope instability. One shrinkage crack was observed on the dam crest near the left abutment. However, no tension crack was apparent. In the absence of seepage and stability analyses, no quantitative evaluation of structural stability of the dam can be made.

There were no signs of structural instability in the spillway chute.

#### b. Design and Construction Data

No design computations were uncovered during the report preparation phase. Seepage and stability analyses comparable to the requirements of the "Recommended Guidelines for Safety Inspection of Dams" were not available. No embankment or foundation soil parameters were available for carrying out a conventional stability analysis on the embankment. No construction data or specifications relating to the degree of

embankment compaction were available for use in a stability analysis.

c. Operating Records

No operating records are available relating to the stability of the dam or appurtenant structures. The water level on the day of the inspection was 1 foot 4 inches below the crest of the spillway, and it is assumed that the reservoir remains close to full at all times.

d. Post Construction Changes

No post construction changes are known to exist which will affect the structural stability of the dam.

e. Seismic Stability

The dam is located in Seismic Zone 1, as defined in "Recommended Guidelines For Safety Inspection of Dams" as prepared by the Corps of Engineers, and therefore, does not require a seismic stability analysis.

## SECTION 7: ASSESSMENT/REMEDIAL MEASURES

### 7.1 Dam Assessment

The assessment of the general condition of the dam is based upon available data and visual inspections. Detailed investigations, testing, and detailed computational evaluations are beyond the scope of a Phase I investigation, however, the investigation is intended to identify any need for such studies.

It should be realized that the reported condition of the dam is based on observations of field conditions at the time of inspection along with data available to the inspection team.

It is also important to note that the condition of a dam depends on numerous and constantly changing internal and external conditions, and is evolutionary in nature. It would be incorrect to assume that the present condition of the dam will continue to represent the condition of the dam at some point in the future. Only through continued care and inspection can there be assurance that an unsafe condition could be detected.

#### a. Safety

The spillway capacity of New Cambria Lake Dam was found to be "Seriously Inadequate". The spillway/reservoir system will accommodate only 30 percent of the PMF without overtopping the dam. The surface soils on the dam is a silty clay. The dam is overtopped over one foot during the PMF and the duration of embankment overflow is over 4-1/2 hours. If the material in the dam is on the clayey side (CL or CH), the dam would be less susceptible to erosion and failure during overtopping than if it is on the silty side (ML).

No quantitative evaluation of the safety of the embankment can be made in view of the absence of seepage and stability analyses. Seepage and stability analyses comparable to the requirements of the "Recommended Guidelines for Safety Inspection of Dams" were not available, which is considered a deficiency. These seepage and stability analyses should be performed for appropriate loading conditions and made a matter of record. The present embankment and appurtenant structures, however, appeared to have performed adequately since their construction without failure. No evidence of the dam ever being overtopped was observed.

The undermining of the downstream end of the spillway chute does not pose a danger to the safety of the spillway in its present condition. Nevertheless, remedial measures should be undertaken within a reasonable period of time.

The downstream channel is obstructed by trees and vegetation. The obstruction should be removed and the channel kept free of trees and debris.

b. Adequacy of Information

Pertinent information relating to the design of the dam and appurtenant structures is completely lacking. The conclusions presented in this report are based on field measurement, past performance and present condition of the dam. No information on the design hydrology, hydraulic design, and the operation and maintenance of the dam were available for review. Seepage and stability analyses comparable to the requirements of the "Recommended Guidelines for Safety Inspection of Dams" were not available, which is considered a deficiency.

c. Urgency

The remedial measures recommended in Paragraph 7.2 should be accomplished within a reasonable period of time. The items recommended in Paragraph 7.2a should be pursued on a high priority basis.

d. Necessity for Phase II Inspection

Based on results of the Phase I inspection, and if the remedial measures recommended in Paragraph 7.2 are undertaken, a Phase II inspection is not felt to be necessary.

7.2 Remedial Measures

a. Alternatives

Spillway capacity and/or height of dam should be increased to accommodate the PMF without overtopping the dam.


b. O & M Procedures

1. Remove the tree on the upstream slope and the heavy vegetative growth observed on both the upstream and downstream slopes and retain an adequate grass cover. Removal of large trees should be under the guidance of an engineer experienced in the design and construction of earthen dams.
2. Repair the undermining of the spillway chute and protect it from further damage.
3. Provide a trashrack for the spillway.


4. Remove the obstruction in the downstream channel.
5. Determine the extent of damage done to the embankment by burrowing animals, if any, and make corrective repairs as required.
6. Monitor the erosion of the upstream slope due to wave action and make repairs as necessary.
7. Seepage and stability analyses should be performed by a professional engineer experienced in the design and construction of earth dams.
8. The owner should initiate the following programs:
  - (a) Periodic inspection of the dam by a professional engineer experienced in the design and construction of earthen dams.
  - (b) Set up a maintenance schedule and log all visits to the dam for operation, repairs and maintenance.

PLATES



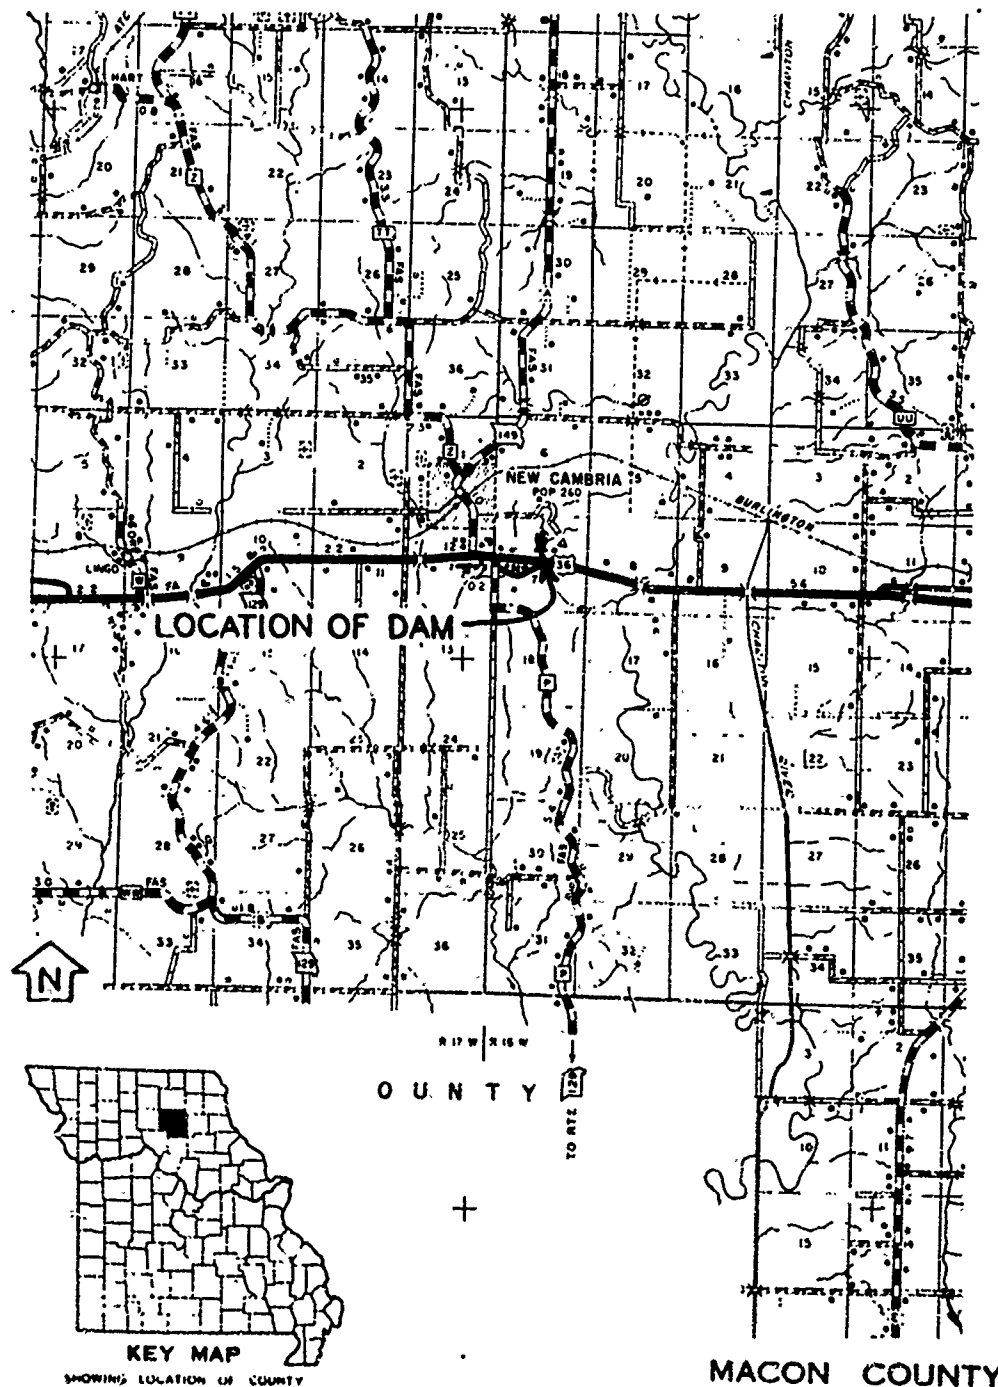


LOCATION MAP - NEW CAMBRIA LAKE DAM

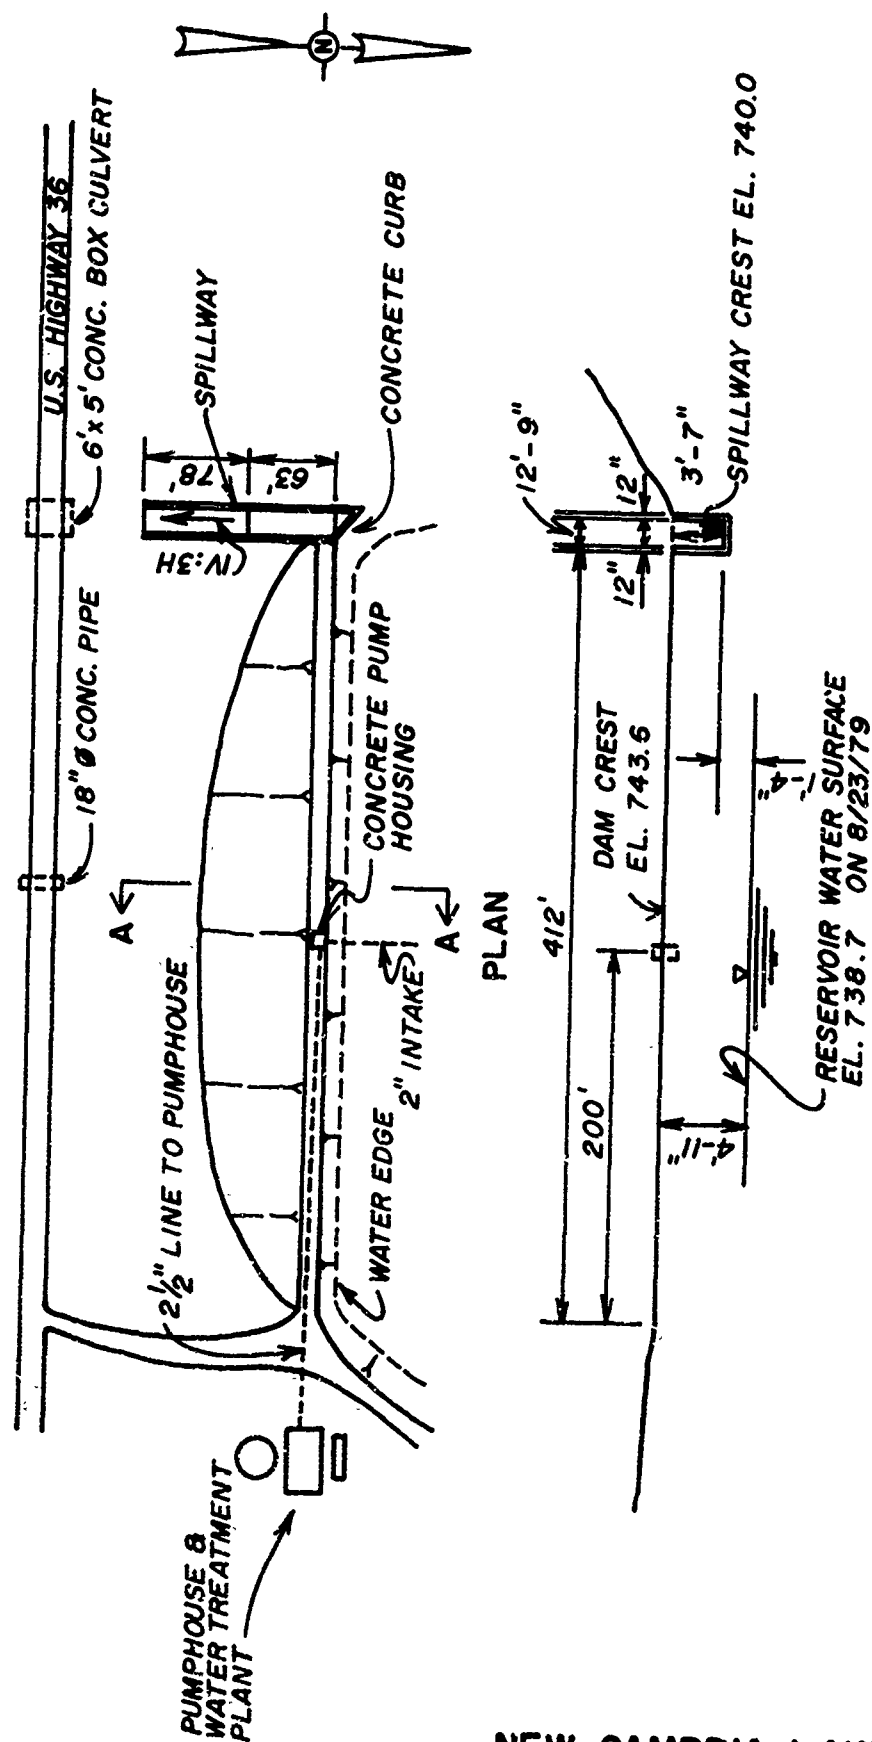

SCALE  
1"=100' (HORIZONTAL)  
VERTICAL (NOT TO SCALE)

NEW CAMBRIA LAKE DAM (MO. 10387)  
PLAN, ELEVATION & SECTION

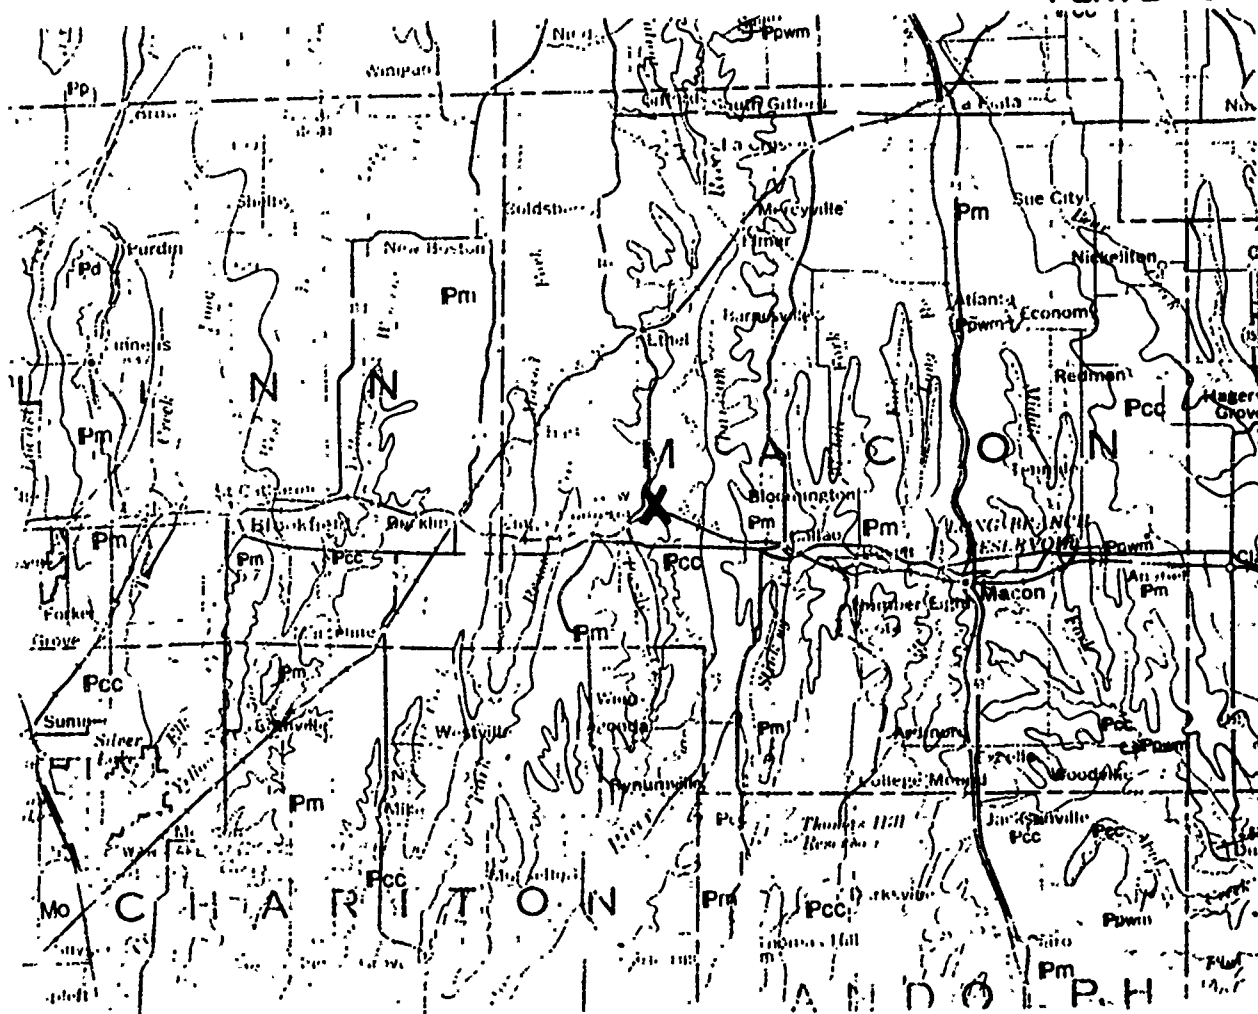

## PENNSYLVANIA N

IPm - MARMATON GROUP  
IPcc - CHEROKEE GROUP,  
CABANISS SUBGROUP


**X - LOCATION OF DAM, MO. 10387**

**REFERENCE:**

**GEOLOGIC MAP OF MISSOURI  
MISSOURI GEOLOGIC SURVEY  
1979**

**GEOLOGIC MAP  
OF  
MACON COUNTY  
AND  
ADJACENT AREA**

From TM 5-809-10, NAYFAC P-355, AFM 88-3, Chapter 13, April 1973

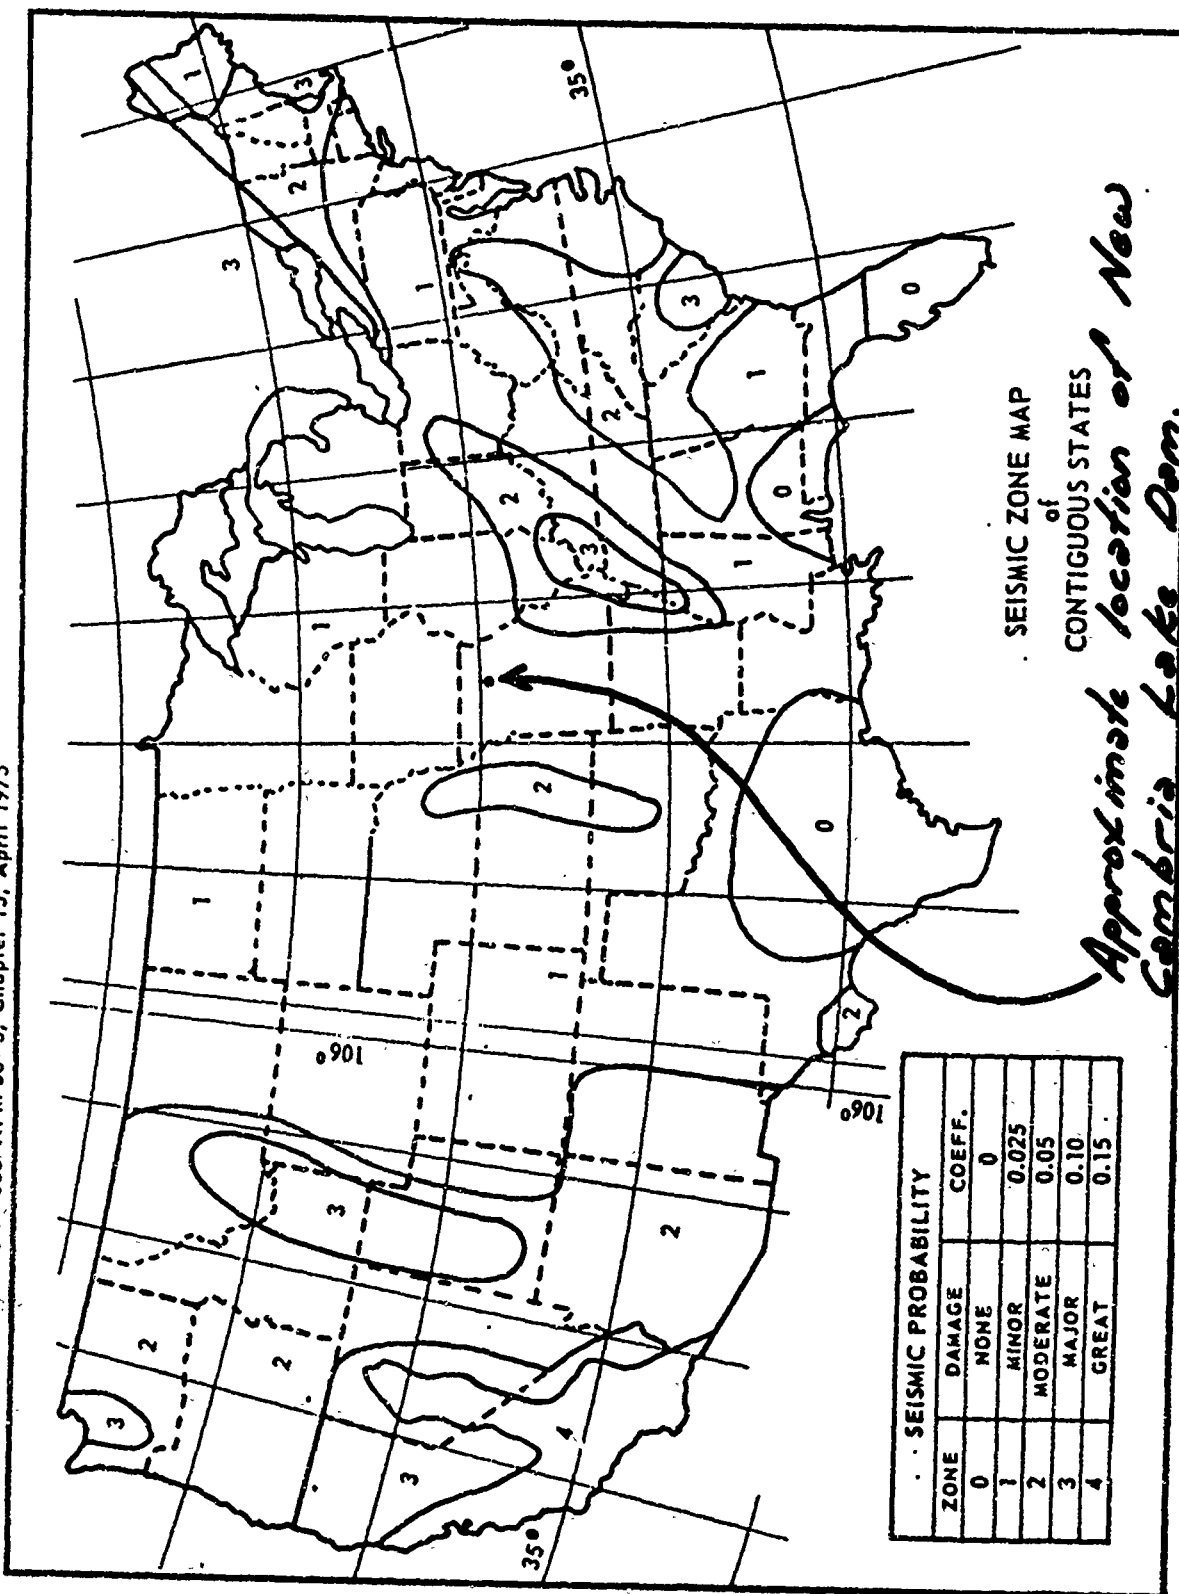

APPENDIX A

PHOTOGRAPHS TAKEN DURING INSPECTION

OVERVIEW

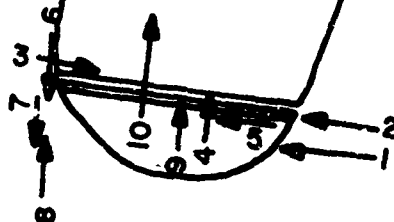


PHOTO INDEX  
FOR  
NEW CAMBRIA LAKE DAM

### New Cambria Lake Dam

- Photo 1. - View of the downstream slope of the embankment.
- Photo 2. - View of the crest. Note the location of the concrete block pit for the pump.
- Photo 3. - View of the upstream slope of the embankment.
- Photo 4. - Closeup view of the riprap on the upstream slope.
- Photo 5. - View of a crack on the crest near the left abutment.
- Photo 6. - View of the spillway looking downstream.
- Photo 7. - View of the discharge channel looking downstream. Note concrete box culvert in background.
- Photo 8. - View of the discharge channel from the downstream end.
- Photo 9. - View of the pump located on the crest of the dam.
- Photo 10. - View of the reservoir rim.

New Cambria Lake Dam



Photo 1



Photo 2



New Cambria Lake Dam



Photo 3



Photo 4

New Cambria Lake Dam



Photo 5



Photo 6

New Cambria Lake Dam



Photo 7



Photo 8

New Cambria Lake Dam



Photo 9


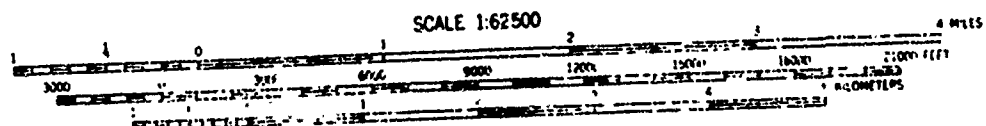


Photo 10

APPENDIX B

HYDROLOGIC COMPUTATIONS

# PLATE I, APPENDIX B

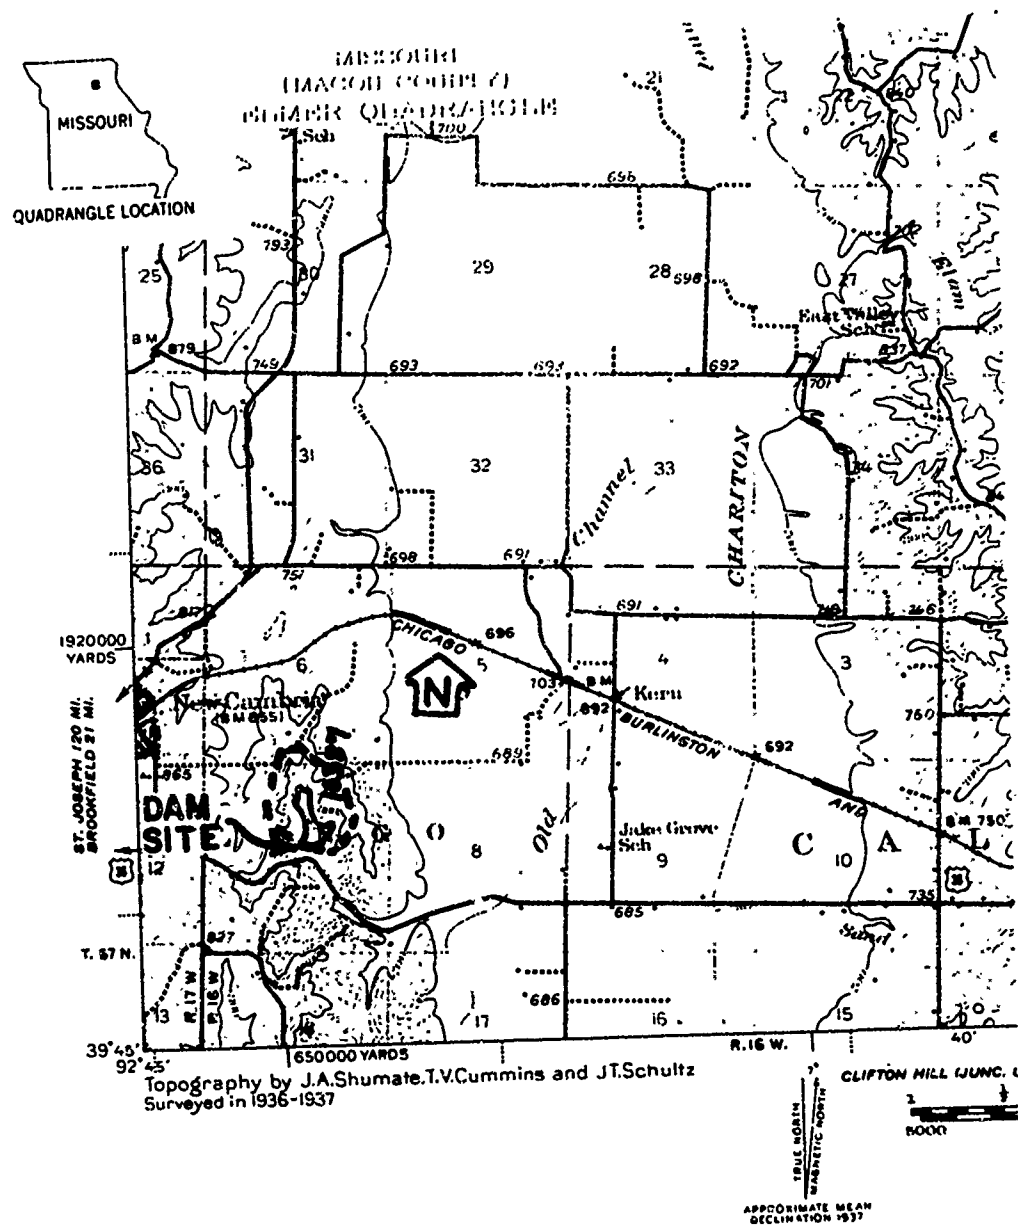

DRAINAGE BOUNDARY — — — — —

NEW CAMBRIA LAKE DAM  
(MO 10387)

DRAINAGE BASIN

DAM SAFETY INSPECTION/MISSOURI


SHEET NO. 1 OF

NEW CAMBRIA LAKE DAM (MO. 10387)

JOB NO. 1240-001


SPILLWAY &amp; OVERTOP RATING CURVE

BY MAS DATE 9-5-

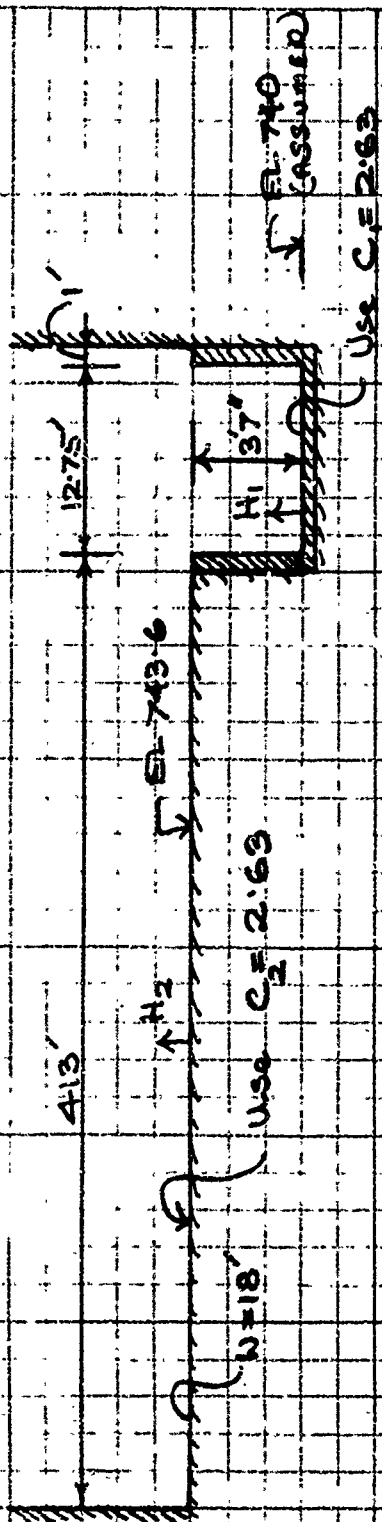

H <sub>1</sub>	L <sub>1</sub>	Q <sub>1</sub>	Q <sub>1</sub> = C <sub>1</sub> L <sub>1</sub> <sup>3/2</sup> H <sub>1</sub> <sup>3/2</sup>	US. W.S. ELEV.	H <sub>2</sub>	L <sub>2</sub>	C <sub>2</sub>	Q <sub>2</sub> = C <sub>2</sub> L <sub>2</sub> <sup>3/2</sup> H <sub>2</sub> <sup>3/2</sup>	Q <sub>2</sub> = Q <sub>1</sub>
-	-	-	0	740	-	-	-	-	0
1.5	12.75	2.63	6.2	741.5	-	-	-	-	6.2
3.6	12.75	2.63	22.9	743.6	-	-	-	-	22.9
4	12.75	2.63	26.8	749	.4	414	2.63	276	548
7	12.75	2.63	62.1	747	3.4	414	2.63	6826	7947
10	12.75	2.63	106.0	750	6.4	414	2.63	17629	18689

PLATE 2

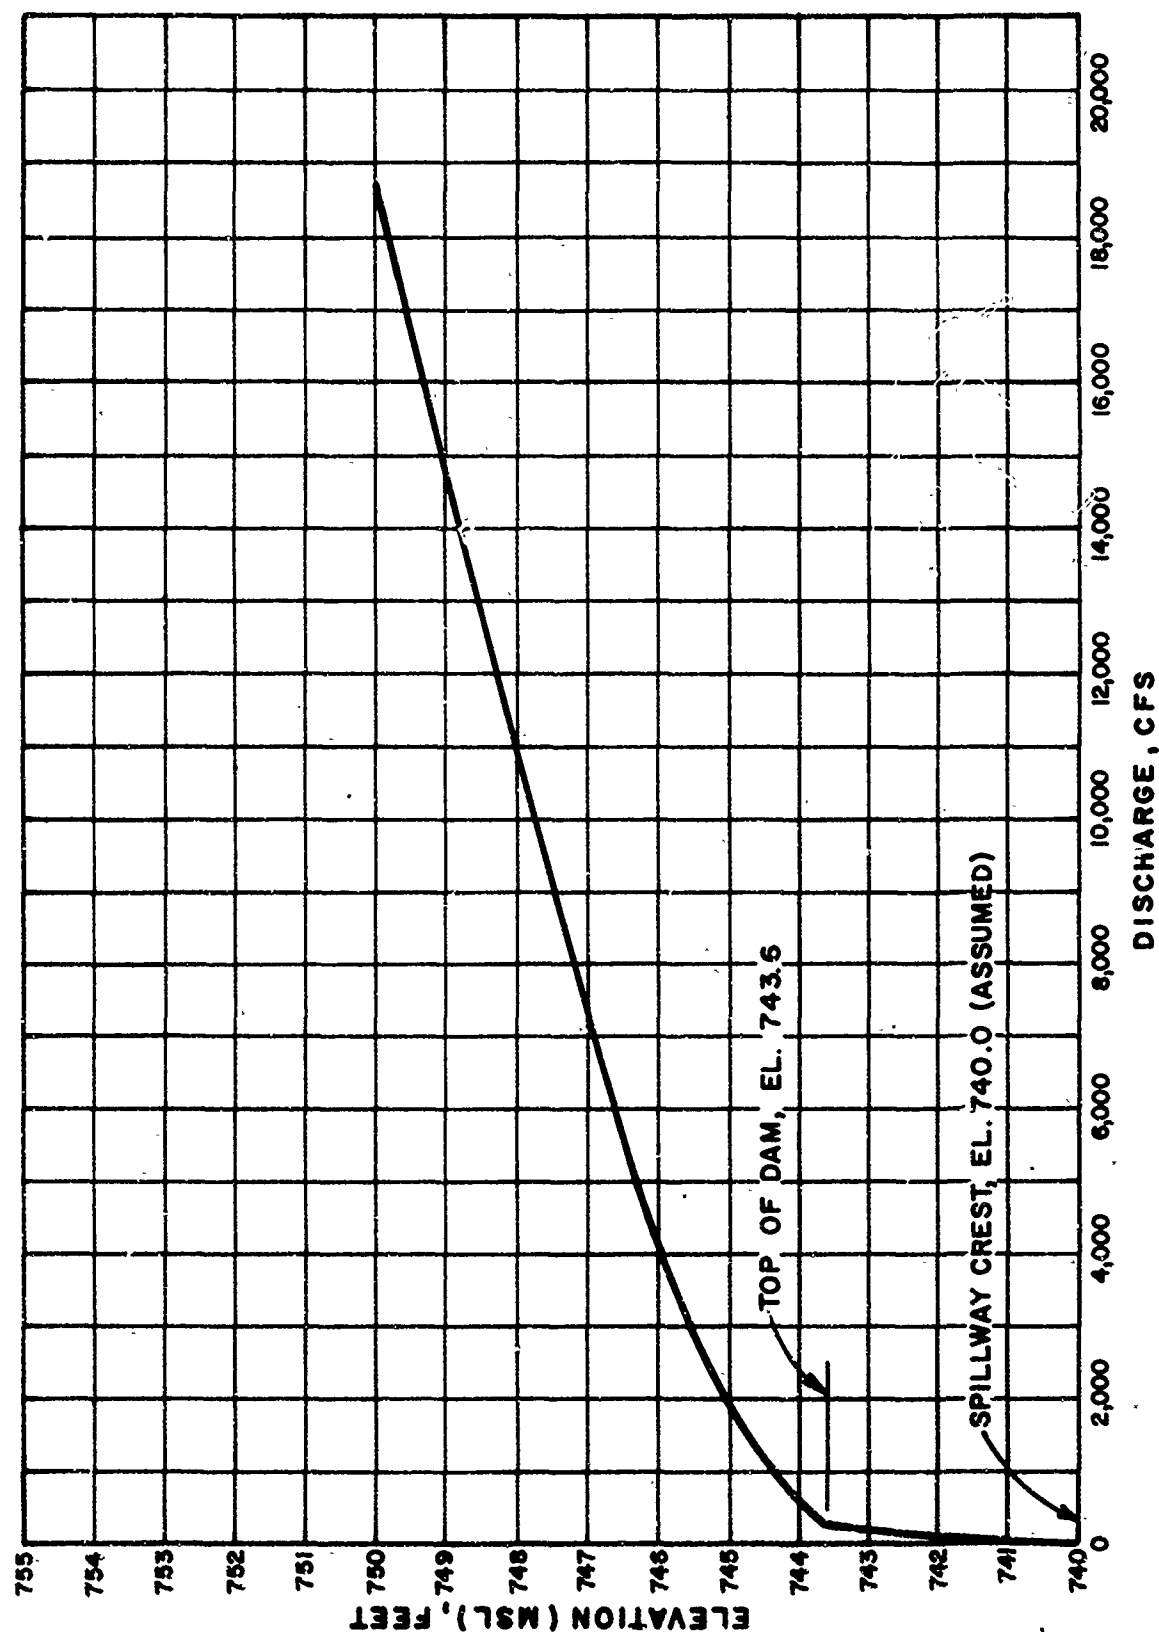

NEW CAMBRIA LAKE DAM (MO. 10387)  
SPILLWAY & OVERTOP RATING CURVE



## DAM SAFETY INSPECTION

SHEET NO. 1 OF 1

NEW CAMBRIA LAKE DAM # 10387

JOB NO. 1240

## RESERVOIR AREA CAPACITY

BY DNE

DATE 31/5/79

RHK


7-12-79

ALV

## NEW CAMBRIA LAKE DAM

## RESERVOIR AREA CAPACITY

ELEV. M.S.L. (FT)	RESERVOIR SURFACE AREA (ACRES)	INCREMENTAL VOLUME (AC-FT)	TOTAL VOLUME (AC-FT)	REMARKS
723	0	0	0	EST. Streambed at Dam site
740	7	40	40	ASSUMED SPILLWAY CREST
743.6	10	30	70	TOP OF DAM
760	31	320	390	
780	62	912	1302	
800	80	1416	2718	

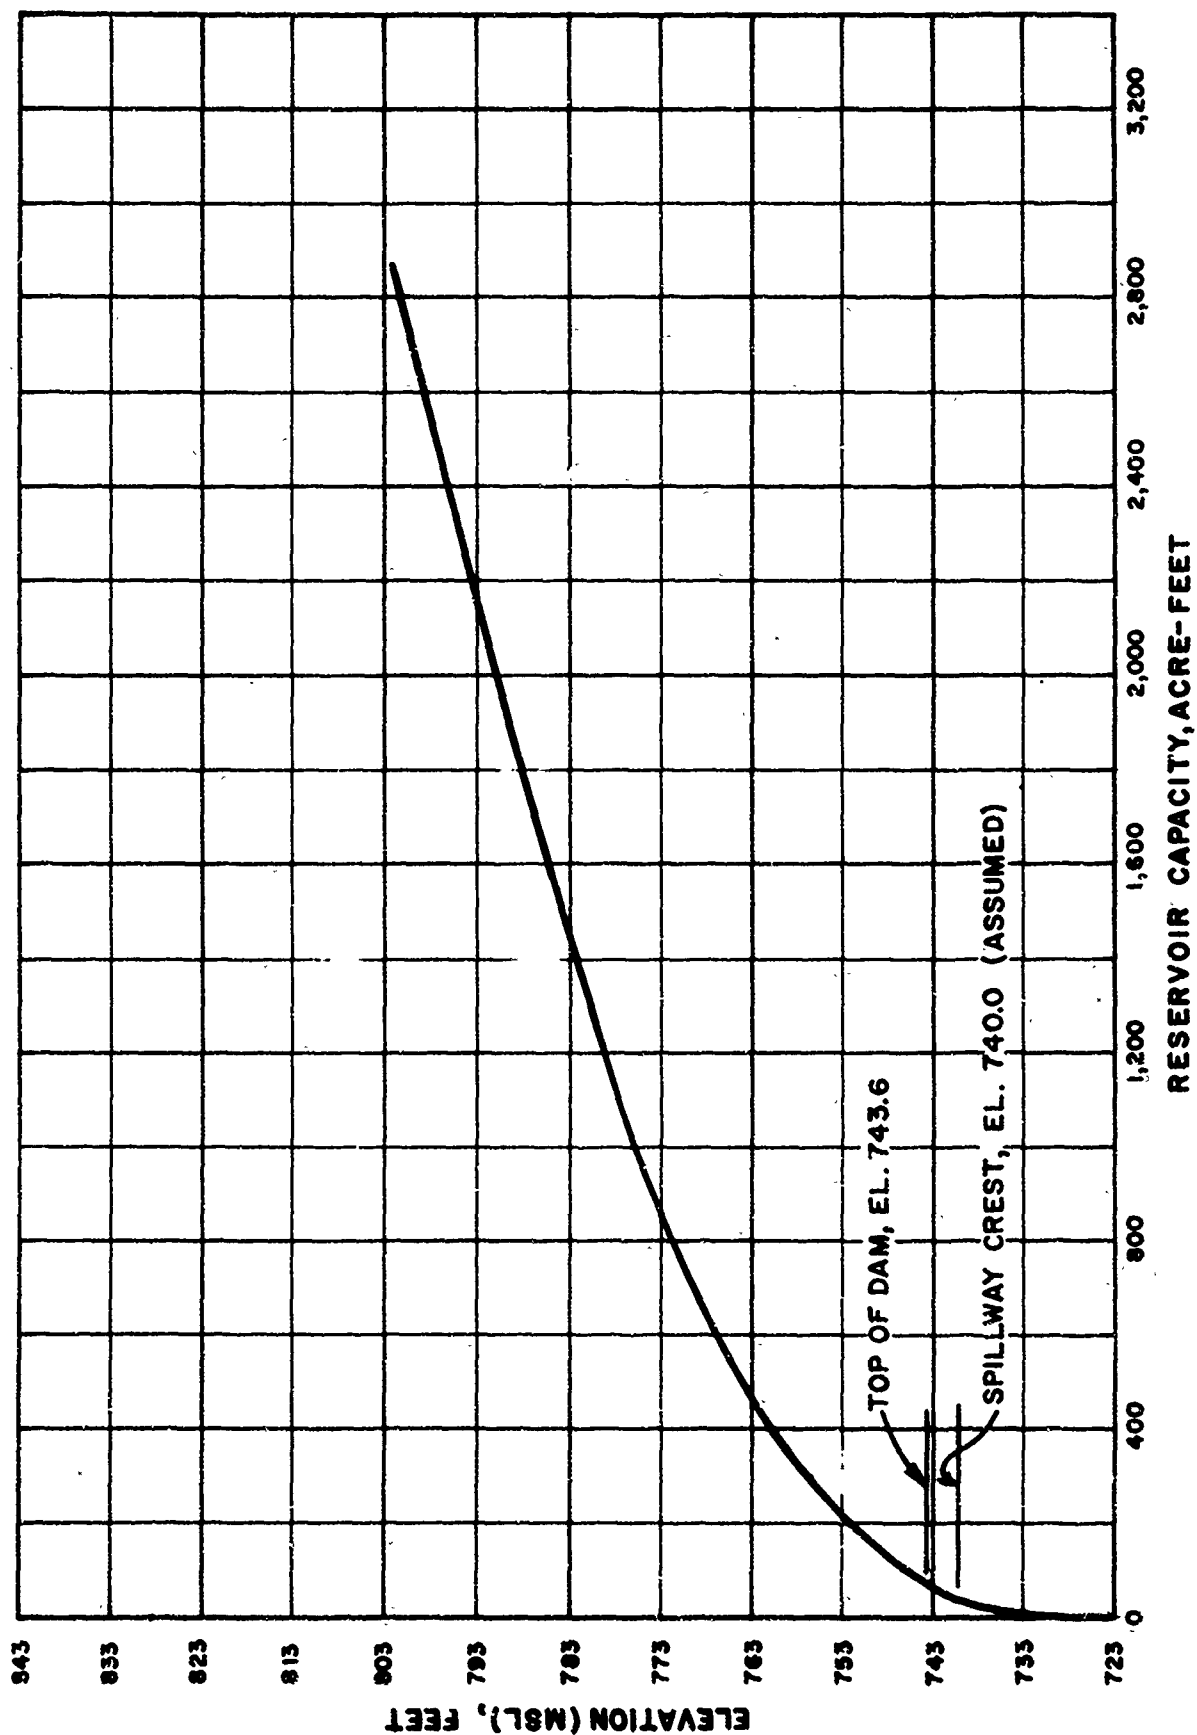

NEW CAMBRIA LAKE DAM (MO. 10387)  
RESERVOIR CAPACITY CURVE

Dam Safety Inspection

SHEET NO. 1 OF

Mizzoua Dam 19387

JOB NO. 1249-001

Reasonable Maximum Precipitation

BY PHL DATE 8-17-79

Dam # Mo. 19387

DETERMINATION OF PMP

## 1.) DETERMINATION OF DRAINAGE AREA

$$D.A. = 117 A.C. (0.18 \text{ Sq. Mi.})$$

2.) DETERMINE PMP INDEX RAINFALL  
(200 Sq. Mi., 24 hr. DURATION)

LOCATION OF CENTER OF BASIN

LONG 92° 43' 56"

LAT 39° 46' 02"


PMP INDEX  
RAINFALL 5.24"3.) DETERMINE BASIN RAINFALL IN TERMS OF  
PERCENTAGE OF PMP INDEX RAINFALL FOR  
VARIOUS DURATIONS:

LOCATION LONG 92° 43' 56"

LAT 39° 46' 02"

⇒ ZONE 7

DURATION (HR)	PERCENT OF INDEX RAINFALL	TOTAL RAINFALL (IN)	RAINFALL INCREMENTS	DURATION OF INCREMENTS
6	100	24.2	24.2	6
12	120	29.1	4.9	6
24	130	31.5	2.4	12

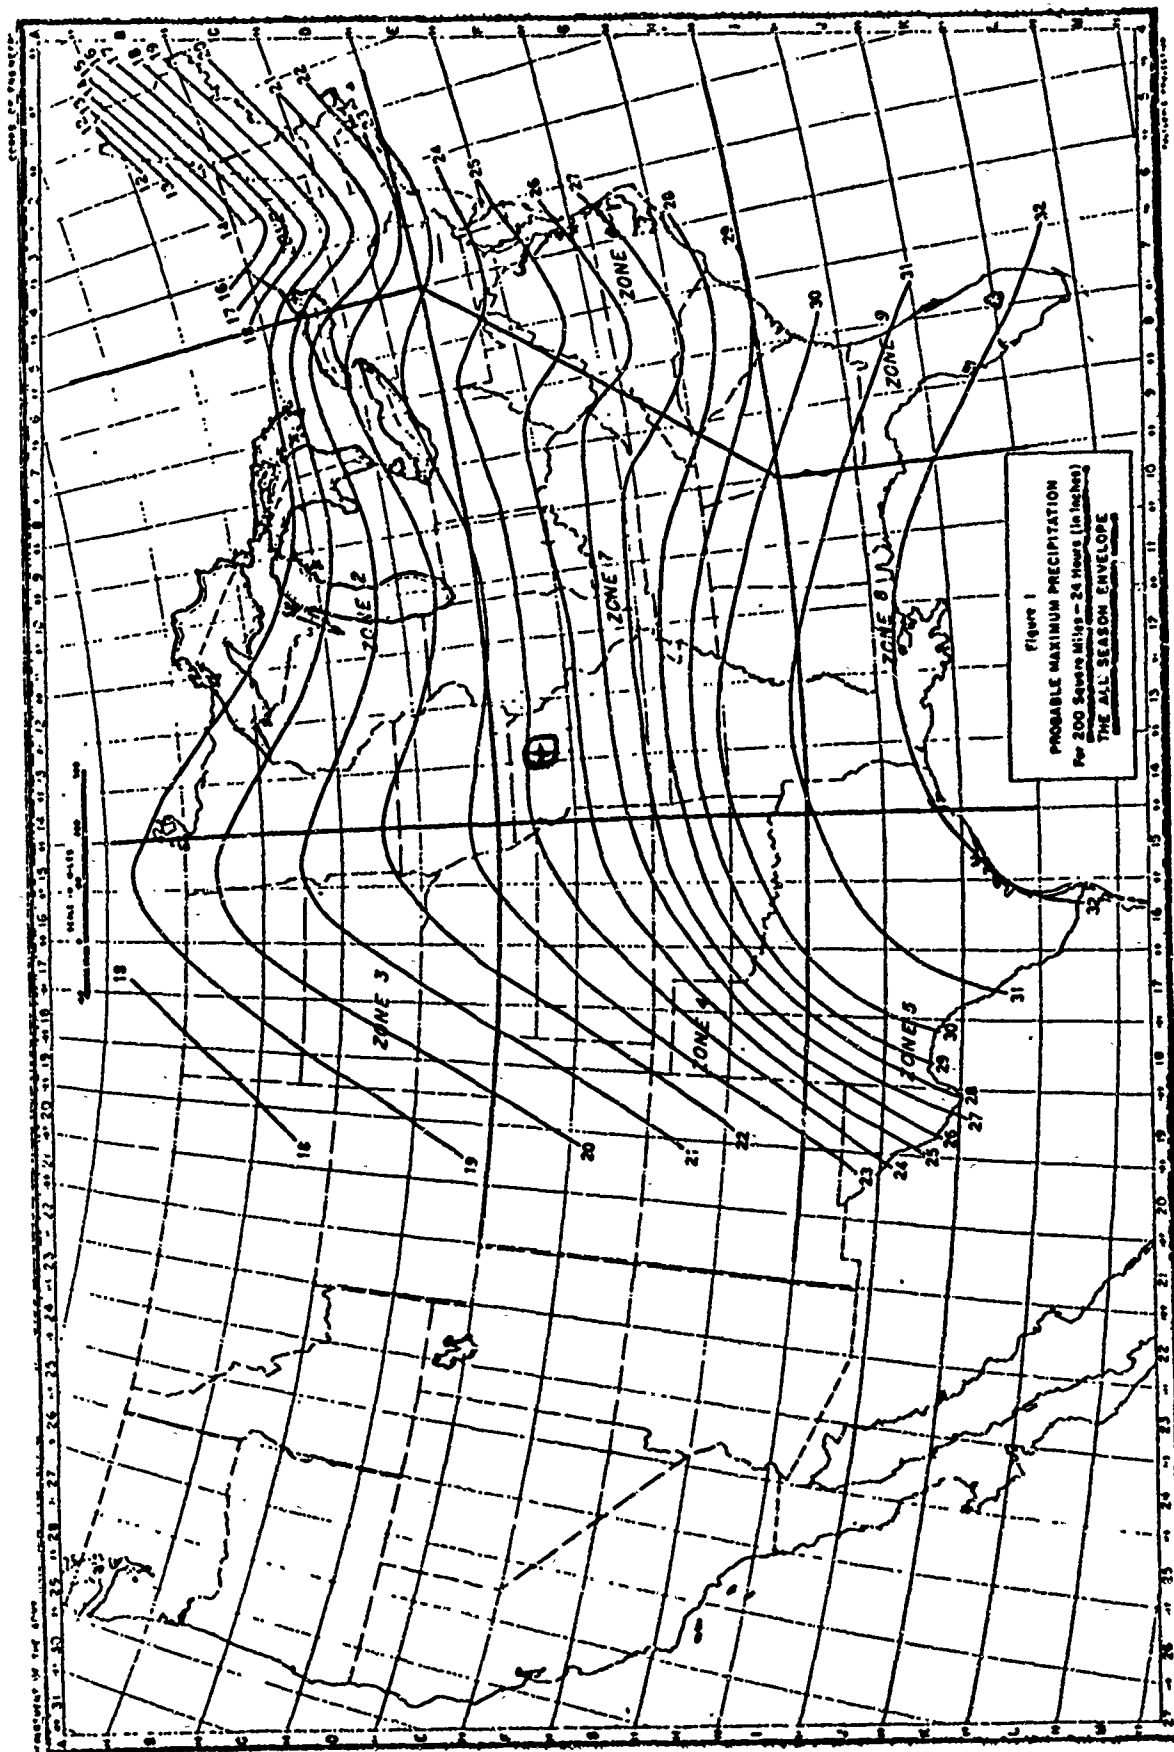

Mb. 10387

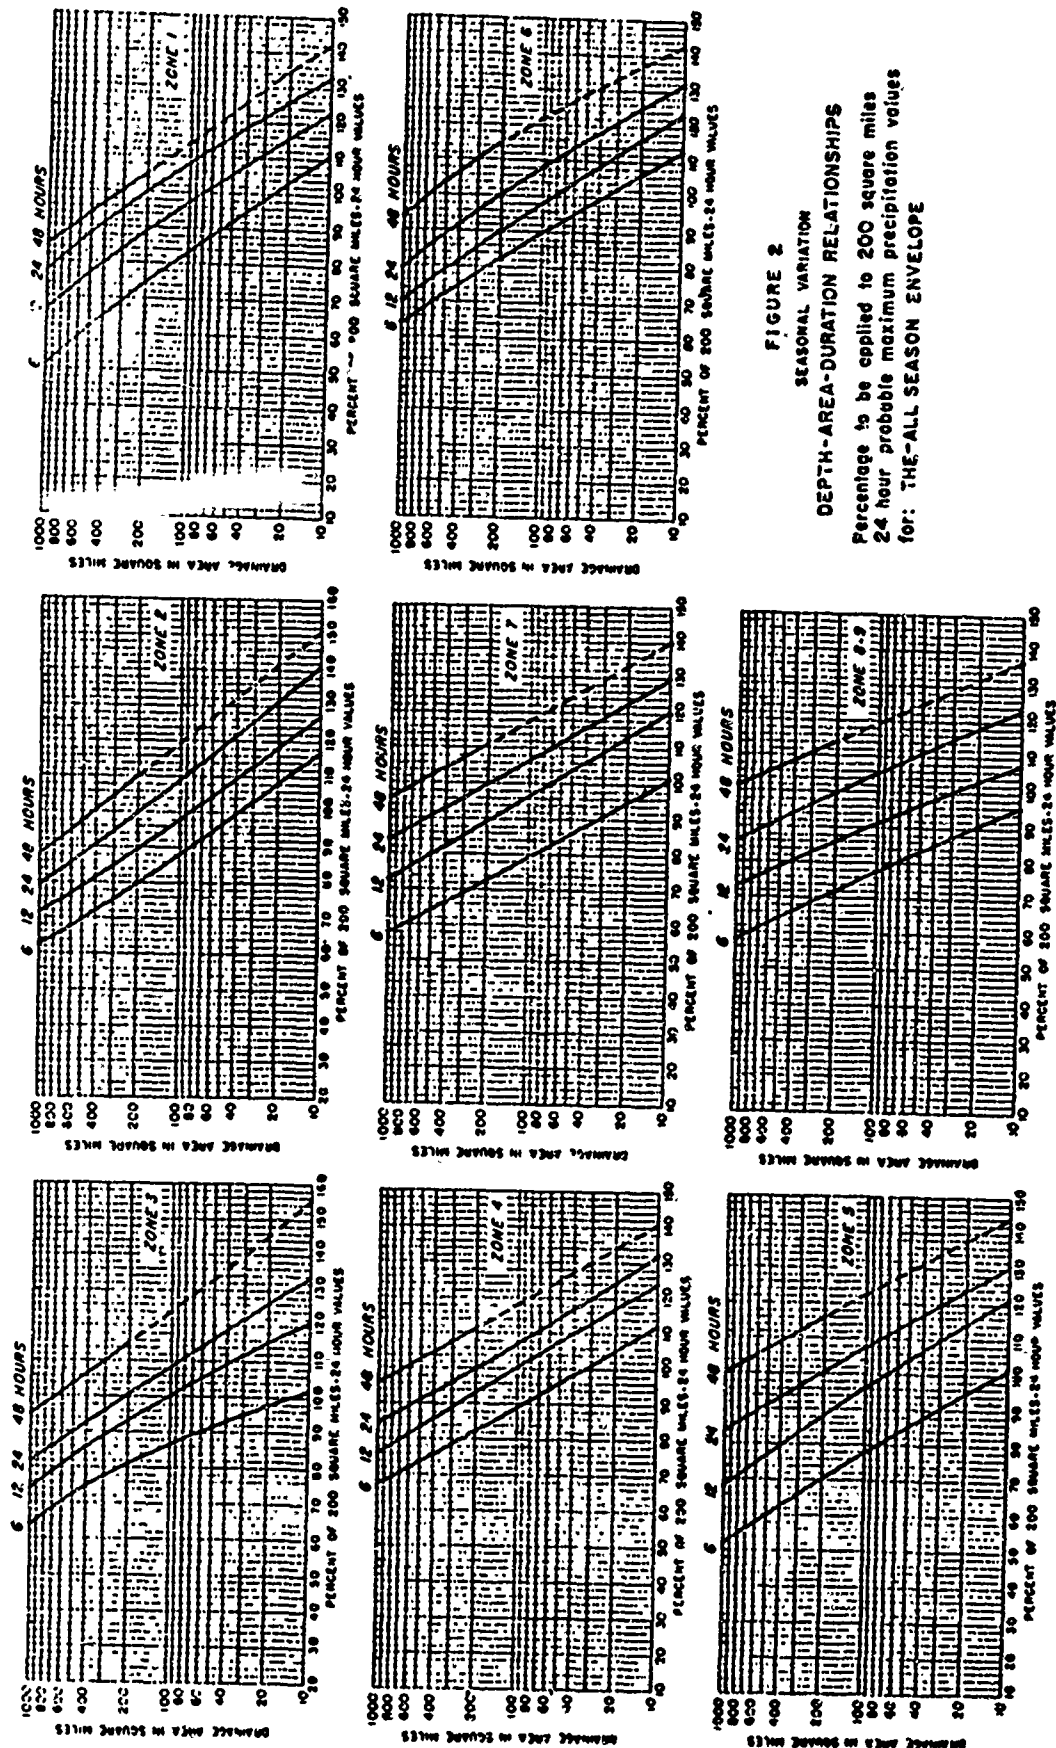


FIGURE 2  
SEASONAL VARIATION  
DEPTH-AREA-DURATION RELATIONSHIPS  
Percentage to be applied to 200 square miles  
24 hour probable maximum precipitation values  
for: THE-ALL SEASON ENVELOPE

DAM SAFETY INSPECTION - MISSOURI SHEET NO. 1 OF

NEW CAMBRIA LAKE DAM JOB NO. 1240-001

UNIT HYDROGRAPH PARAMETERS. BY KLB DATE 8-21-  
JPR

1.) DRAINAGE AREA - 117 AC.  $\approx$  0.18 SQ. MI.

2.) LENGTH OF STREAM =  $(1.4 \times \frac{6000}{12}) = 2083 \text{ FT} = 0.38 \text{ MI}$

3.) ELEVATION AT DRAINAGE DIVIDE ALONG THE  
LONGEST STREAM  $H_1 = 850'$

4.) RESERVOIR ELEVATION AT SPILLWAY CREST,  $H_2 = 740$

5.) DIFFERENCE IN ELEVATION,  $\Delta H = 850 - 740 = 110'$

6.) AVERAGE SLOPE OF STREAM =  $\frac{\Delta H}{L} = \frac{110}{2083} = 5.3\%$

7.) TIME OF CONCENTRATION:

a) BY KIRPICH FORMULA:

$$T_c = \left( \frac{11.9 \times L^3}{\Delta H} \right)^{0.385} = \left( \frac{11.9 \times 0.38^3}{110} \right)^{0.385}$$

$$T_c = 0.14 \text{ HR}$$

b) BY VELOCITY ESTIMATE:

AVERAGE SLOPE = 5.3%  $\Rightarrow V = 3 \text{ FPS}$

$$T_c = \frac{L}{V} = \frac{2083}{3 \times 5280} = 0.19 \text{ HR}$$

USE  $T_c = 0.14 \text{ HR}$

8.) LAG TIME =  $0.6 \times T_c = 0.6 \times 0.14 = 0.084 \text{ HR}$

9.) UNIT DURATION  $D \approx \frac{L}{V} = \frac{0.084}{3} = 0.028 \text{ HR}$

USE  $D = 0.023 \text{ HR} = 5 \text{ MIN.}$

10.) TIME TO PEAK,  $T_p = \frac{D}{2} + L_c = \frac{0.023}{2} + 0.084 = 0.126 \text{ HR}$

11.) PEAK DISCHARGE,  $q_p = \frac{484 \cdot A}{T_p} = \frac{484 \times 0.18}{0.126}$

$$q_p = 691 \text{ CFS}$$

## PRC ENGINEERING CONSULTANTS, INC.

DAM SAFETY INSPECTION - MISSOURI

SHEET NO. 1 OF

NEW CAMBRIA LAKE DAM (10387)

JOB NO. 1240-001-1

SOIL GROUP AND CURVE NUMBER

BY KLB

DATE 8-21-

1980

NEW CAMBRIA LAKE DAM

HYDROLOGIC SOIL GROUP AND CURVE NUMBER

1. WATERSHED SOILS CONSIST PRIMARILY OF GROUP C AND GROUP D SOILS, WITH GROUP C BEING PREDOMINANT. ASSUME GROUP C FOR THE ENTIRE WATERSHED.

2. THIS WATERSHED IS PRIMARILY FLOODED. ASSUME THE HYDROLOGIC CONDITION OF THIS WATERSHED IS "FAIR".

THIS  $CN = 73$  (WOODS) for Group C SOILS WITH  $AMC$  II.

⇒  $CN = 87$  WITH  $AMC$  III



DECIDE INPUT DATA



\*\*\*\*\*  
 FLOOD HYDROGRAPH PACKAGE (FHC-11)  
 DAM SAFETY VERSION JULY 1978  
 LAST MODIFICATION 26 FEB 79  
 \*\*\*\*\*

DAM SAFETY INSPECTION - MISSOURI  
 NEW CAMBRIA LAKE DAM (P0-10387)  
 PHF AND 50 PERCENT PHF

5 0 0 0 0 0

A1  
 A2  
 A3  
 R 300  
 S1 5  
 J 1  
 J1 1  
 J2 2  
 J3 1  
 J4 1  
 J5 1  
 J6 1  
 J7 1  
 J8 1  
 J9 1  
 J10 1  
 J11 1  
 J12 1  
 J13 1  
 J14 1  
 J15 1  
 J16 1  
 J17 1  
 J18 1  
 J19 1  
 J20 1  
 J21 1  
 J22 1  
 J23 1  
 J24 1  
 J25 1  
 J26 1  
 J27 1  
 J28 1  
 J29 1  
 J30 1  
 J31 1  
 J32 1  
 J33 1  
 J34 1  
 J35 1  
 J36 1  
 J37 1  
 J38 1  
 J39 1  
 J40 1  
 J41 1  
 J42 1  
 J43 1  
 J44 1  
 J45 1  
 J46 1  
 J47 1  
 J48 1  
 J49 1  
 J50 1  
 J51 1  
 J52 1  
 J53 1  
 J54 1  
 J55 1  
 J56 1  
 J57 1  
 J58 1  
 J59 1  
 J60 1  
 J61 1  
 J62 1  
 J63 1  
 J64 1  
 J65 1  
 J66 1  
 J67 1  
 J68 1  
 J69 1  
 J70 1  
 J71 1  
 J72 1  
 J73 1  
 J74 1  
 J75 1  
 J76 1  
 J77 1  
 J78 1  
 J79 1  
 J80 1  
 J81 1  
 J82 1  
 J83 1  
 J84 1  
 J85 1  
 J86 1  
 J87 1  
 J88 1  
 J89 1  
 J90 1  
 J91 1  
 J92 1  
 J93 1  
 J94 1  
 J95 1  
 J96 1  
 J97 1  
 J98 1  
 J99 1  
 J100 1

\*\*\*\*\*  
 INPUT PRECIPITATION VALUES, RATIOS AND UNIT HYDROGRAPH PARAMETERS  
 0.16 0.16 1  
 2 0.16 1  
 20.2 100 120 130  
 T 1  
 V1 0.884  
 V2 1  
 V3 1  
 V4 1  
 V5 1  
 V6 1  
 V7 1  
 V8 1  
 V9 1  
 V10 1  
 V11 1  
 V12 1  
 V13 1  
 V14 1  
 V15 1  
 V16 1  
 V17 1  
 V18 1  
 V19 1  
 V20 1  
 V21 1  
 V22 1  
 V23 1  
 V24 1  
 V25 1  
 V26 1  
 V27 1  
 V28 1  
 V29 1  
 V30 1  
 V31 1  
 V32 1  
 V33 1  
 V34 1  
 V35 1  
 V36 1  
 V37 1  
 V38 1  
 V39 1  
 V40 1  
 V41 1  
 V42 1  
 V43 1  
 V44 1  
 V45 1  
 V46 1  
 V47 1  
 V48 1  
 V49 1  
 V50 1  
 V51 1  
 V52 1  
 V53 1  
 V54 1  
 V55 1  
 V56 1  
 V57 1  
 V58 1  
 V59 1  
 V60 1  
 V61 1  
 V62 1  
 V63 1  
 V64 1  
 V65 1  
 V66 1  
 V67 1  
 V68 1  
 V69 1  
 V70 1  
 V71 1  
 V72 1  
 V73 1  
 V74 1  
 V75 1  
 V76 1  
 V77 1  
 V78 1  
 V79 1  
 V80 1  
 V81 1  
 V82 1  
 V83 1  
 V84 1  
 V85 1  
 V86 1  
 V87 1  
 V88 1  
 V89 1  
 V90 1  
 V91 1  
 V92 1  
 V93 1  
 V94 1  
 V95 1  
 V96 1  
 V97 1  
 V98 1  
 V99 1  
 V100 1

\*\*\*\*\*  
 ROUTE HYDROGRAPH THROUGH NEW CAMBRIA LAKE DAM  
 1 1  
 V1 741.5 743.6 744 747 750  
 V2 62 229 544 747 1068  
 V3 49 70 398 1332 2718  
 V4 700 743.6 750 750 800  
 V5 54 740  
 V6 50 743.6  
 V7 99

-1 -87

-1 -740

INFLOW PMF AND ONE-HALF PMF HYDROGRAPHS

PREVIEW OF SEQUENCE OF STREAM NETWORK CALCULATIONS

RUNOFF HYDROGRAPH AT 10287  
ROUTE HYDROGRAPH TO 10157  
END OF NETWORK

RJN Date: 7/3/09/270  
Time: 03:05:51

DAK SAFETY INSPECTION - MISSOURI  
NEW CAMBRIA LAKE DAK (70.1381)  
PMF AND 50 PERCENT PMF

ΕΠΙΧΕΙΡΗΣΙΑΚΟ ΠΡΟΓΡΑΜΜΑ

DOY	THR	IMV	MEPC	IMPT	ASTAN
0	0	0	0	0	0
JOPER	5	0	0	0	0

MULTI-PLAY ANALYSES TO BE PERFORMED  
HPLAN# 1 NRATIO= 2 LATIO= 1

RTIOS= 1.00 .50

1. CITIZENSHIP AND VOTING

### INPUT PRECIPITATION VALUES, RATIOS AND UNIT HYDROGRAPH PARAMETERS

ICSTAQ	ICOMP	IECON	IIAGE	JPLI	JPRF	INAME	ISTAGE	IAUTQ
19347	0	0	0	3	0	0	0	0

5166 HAVAGUCUHAN

HYDROGRAPH DATA	TRSDA	TRSPC	RATIO	ISNOV	ISANE	LOCAL
	015	1000	0.0000	0	0	0

**087C13 01TA**

PRECIP. UNITA ... 348 872 995  
K12 P24 120-00 150-30 200-00 200-00

Loss: Data

LOSS DATA	RTIOK	SYRTL	CHSTL	ALSMX	RTIMP
IN	SYRKS				
90	9.00	-1.00	-27.00	3.00	5.00

CURVE NO 3, 47.00, FITNESS = -1.00, EFFECT = 97.00

UNIT HYDROGRAPH DATA  
IC= 0.00 LAG= .08

## RECESSION DATA

RTIO# 1000

TIME INCREMENT TOO LARGE--INMG IS GT LAG(?)

UNIT HYDROGRAPH 7 END OF PERIOD ORDINATES, TC= . 3.00 HOURS, LAG= .08 VOL= 1.00

NO.	HR.	MIN.	PERIOD	RAID	EXCS	LOSS	END-OF-PERIOD FLOW	HR.	MIN.	PERIOD	RAIN	EXCS	LOSS	COMP
1	0.05	1	1	0.01	0.00	0.01	1.01	12.35	151	0.0	0.0	0.0	0.0	271.
2	0.10	2	1	0.01	0.00	0.01	1.01	12.40	152	0.0	0.0	0.0	0.0	272.
3	0.15	3	1	0.01	0.00	0.01	1.01	12.45	153	0.0	0.0	0.0	0.0	273.
4	0.20	4	1	0.01	0.00	0.01	1.01	12.50	154	0.0	0.0	0.0	0.0	274.
5	0.25	5	1	0.01	0.00	0.01	1.01	12.55	155	0.0	0.0	0.0	0.0	275.
6	0.30	6	1	0.01	0.00	0.01	1.01	13.00	156	0.0	0.0	0.0	0.0	276.
7	0.35	7	1	0.01	0.00	0.01	1.01	13.05	157	0.0	0.0	0.0	0.0	277.
8	0.40	8	1	0.01	0.00	0.01	1.01	13.10	158	0.0	0.0	0.0	0.0	278.
9	0.45	9	1	0.01	0.00	0.01	1.01	13.15	159	0.0	0.0	0.0	0.0	279.
10	0.50	10	1	0.01	0.00	0.01	1.01	13.20	160	0.0	0.0	0.0	0.0	280.
11	0.55	11	1	0.01	0.00	0.01	1.01	13.25	161	0.0	0.0	0.0	0.0	281.
12	1.00	12	1	0.01	0.00	0.01	1.01	13.30	162	0.0	0.0	0.0	0.0	282.
13	1.05	13	1	0.01	0.00	0.01	1.01	13.35	163	0.0	0.0	0.0	0.0	283.
14	1.10	14	1	0.01	0.00	0.01	1.01	13.40	164	0.0	0.0	0.0	0.0	284.
15	1.15	15	1	0.01	0.00	0.01	1.01	13.45	165	0.0	0.0	0.0	0.0	285.
16	1.20	16	1	0.01	0.00	0.01	1.01	13.50	166	0.0	0.0	0.0	0.0	286.
17	1.25	17	1	0.01	0.00	0.01	1.01	13.55	167	0.0	0.0	0.0	0.0	287.
18	1.30	18	1	0.01	0.00	0.01	1.01	14.00	168	0.0	0.0	0.0	0.0	288.
19	1.35	19	1	0.01	0.00	0.01	1.01	14.05	169	0.0	0.0	0.0	0.0	289.
20	1.40	20	1	0.01	0.00	0.01	1.01	14.10	170	0.0	0.0	0.0	0.0	290.
21	1.45	21	1	0.01	0.00	0.01	1.01	14.15	171	0.0	0.0	0.0	0.0	291.
22	1.50	22	1	0.01	0.00	0.01	1.01	14.20	172	0.0	0.0	0.0	0.0	292.
23	1.55	23	1	0.01	0.00	0.01	1.01	14.25	173	0.0	0.0	0.0	0.0	293.
24	2.00	24	1	0.01	0.00	0.01	1.01	14.30	174	0.0	0.0	0.0	0.0	294.
25	2.05	25	1	0.01	0.00	0.01	1.01	14.35	175	0.0	0.0	0.0	0.0	295.
26	2.10	26	1	0.01	0.00	0.01	1.01	14.40	176	0.0	0.0	0.0	0.0	296.
27	2.15	27	1	0.01	0.00	0.01	1.01	14.45	177	0.0	0.0	0.0	0.0	297.
28	2.20	28	1	0.01	0.00	0.01	1.01	14.50	178	0.0	0.0	0.0	0.0	298.
29	2.25	29	1	0.01	0.00	0.01	1.01	14.55	179	0.0	0.0	0.0	0.0	299.
30	2.30	30	1	0.01	0.00	0.01	1.01	15.00	180	0.0	0.0	0.0	0.0	300.
31	2.35	31	1	0.01	0.00	0.01	1.01	15.05	181	0.0	0.0	0.0	0.0	301.
32	2.40	32	1	0.01	0.00	0.01	1.01	15.10	182	0.0	0.0	0.0	0.0	302.
33	2.45	33	1	0.01	0.00	0.01	1.01	15.15	183	0.0	0.0	0.0	0.0	303.
34	2.50	34	1	0.01	0.00	0.01	1.01	15.20	184	0.0	0.0	0.0	0.0	304.
35	2.55	35	1	0.01	0.00	0.01	1.01	15.25	185	0.0	0.0	0.0	0.0	305.
36	3.00	36	1	0.01	0.00	0.01	1.01	15.30	186	0.0	0.0	0.0	0.0	306.
37	3.05	37	1	0.01	0.00	0.01	1.01	15.35	187	0.0	0.0	0.0	0.0	307.
38	3.10	38	1	0.01	0.00	0.01	1.01	15.40	188	0.0	0.0	0.0	0.0	308.
39	3.15	39	1	0.01	0.00	0.01	1.01	15.45	189	0.0	0.0	0.0	0.0	309.
40	3.20	40	1	0.01	0.00	0.01	1.01	15.50	190	0.0	0.0	0.0	0.0	310.
41	3.25	41	1	0.01	0.00	0.01	1.01	15.55	191	0.0	0.0	0.0	0.0	311.
42	3.30	42	1	0.01	0.00	0.01	1.01	16.00	192	0.0	0.0	0.0	0.0	312.
43	3.35	43	1	0.01	0.00	0.01	1.01	16.05	193	0.0	0.0	0.0	0.0	313.
44	3.40	44	1	0.01	0.00	0.01	1.01	16.10	194	0.0	0.0	0.0	0.0	314.
45	3.45	45	1	0.01	0.00	0.01	1.01	16.15	195	0.0	0.0	0.0	0.0	315.
46	3.50	46	1	0.01	0.00	0.01	1.01	16.20	196	0.0	0.0	0.0	0.0	316.
47	3.55	47	1	0.01	0.00	0.01	1.01	16.25	197	0.0	0.0	0.0	0.0	317.
48	4.00	48	1	0.01	0.00	0.01	1.01	16.30	198	0.0	0.0	0.0	0.0	318.
49	4.05	49	1	0.01	0.00	0.01	1.01	16.35	199	0.0	0.0	0.0	0.0	319.
50	4.10	50	1	0.01	0.00	0.01	1.01	16.40	200	0.0	0.0	0.0	0.0	320.
51	4.15	51	1	0.01	0.00	0.01	1.01	16.45	201	0.0	0.0	0.0	0.0	321.
52	4.20	52	1	0.01	0.00	0.01	1.01	16.50	202	0.0	0.0	0.0	0.0	322.
53	4.25	53	1	0.01	0.00	0.01	1.01	16.55	203	0.0	0.0	0.0	0.0	323.
54	4.30	54	1	0.01	0.00	0.01	1.01	17.00	204	0.0	0.0	0.0	0.0	324.
55	4.35	55	1	0.01	0.00	0.01	1.01	17.05	205	0.0	0.0	0.0	0.0	325.

1.01	4.00	56	.01	.01	.01	7.	1.01	17.15	204	.22	.22	.00	300.
1.01	4.05	57	.01	.01	.01	8.	1.01	17.15	207	.22	.22	.00	314.
1.01	4.08	58	.01	.01	.01	8.	1.01	17.20	208	.22	.22	.00	310.
1.01	4.05	57	.01	.01	.01	8.	1.01	17.25	209	.22	.22	.00	309.
1.01	5.08	60	.01	.01	.01	9.	1.01	17.30	210	.22	.22	.00	308.
1.01	5.05	61	.01	.01	.01	9.	1.01	17.35	211	.22	.22	.00	308.
1.01	5.10	62	.01	.01	.01	9.	1.01	17.40	212	.22	.22	.00	308.
1.01	5.15	63	.01	.01	.01	9.	1.01	17.45	213	.22	.22	.00	308.
1.01	5.20	64	.01	.01	.01	9.	1.01	17.50	214	.22	.22	.00	308.
1.01	5.25	65	.01	.01	.01	9.	1.01	17.55	215	.22	.22	.00	308.
1.01	5.30	66	.01	.01	.01	9.	1.01	18.00	216	.22	.22	.00	308.
1.01	5.35	67	.01	.01	.01	9.	1.01	18.05	217	.22	.22	.00	308.
1.01	5.40	68	.01	.01	.01	9.	1.01	18.10	218	.22	.22	.00	308.
1.01	5.45	69	.01	.01	.01	9.	1.01	18.15	219	.22	.22	.00	308.
1.01	5.50	70	.01	.01	.01	9.	1.01	18.20	220	.22	.22	.00	308.
1.01	5.55	71	.01	.01	.01	10.	1.01	18.25	221	.22	.22	.00	308.
1.01	6.00	72	.01	.01	.01	10.	1.01	18.30	222	.22	.22	.00	308.
1.01	6.05	73	.01	.01	.01	10.	1.01	18.35	223	.22	.22	.00	308.
1.01	6.10	74	.01	.01	.01	10.	1.01	18.40	224	.22	.22	.00	308.
1.01	6.15	75	.01	.01	.01	10.	1.01	18.45	225	.22	.22	.00	308.
1.01	6.20	76	.01	.01	.01	10.	1.01	18.50	226	.22	.22	.00	308.
1.01	6.25	77	.01	.01	.01	10.	1.01	18.55	227	.22	.22	.00	308.
1.01	6.30	78	.01	.01	.01	10.	1.01	19.00	228	.22	.22	.00	308.
1.01	6.35	79	.01	.01	.01	10.	1.01	19.05	229	.22	.22	.00	308.
1.01	6.40	80	.01	.01	.01	10.	1.01	19.10	230	.22	.22	.00	308.
1.01	6.45	81	.01	.01	.01	10.	1.01	19.15	231	.22	.22	.00	308.
1.01	6.50	82	.01	.01	.01	10.	1.01	19.20	232	.22	.22	.00	308.
1.01	6.55	83	.01	.01	.01	10.	1.01	19.25	233	.22	.22	.00	308.
1.01	7.00	84	.01	.01	.01	10.	1.01	19.30	234	.22	.22	.00	308.
1.01	7.05	85	.01	.01	.01	10.	1.01	19.35	235	.22	.22	.00	308.
1.01	7.10	86	.01	.01	.01	10.	1.01	19.40	236	.22	.22	.00	308.
1.01	7.15	87	.01	.01	.01	10.	1.01	19.45	237	.22	.22	.00	308.
1.01	7.20	88	.01	.01	.01	10.	1.01	19.50	238	.22	.22	.00	308.
1.01	7.25	89	.01	.01	.01	10.	1.01	19.55	239	.22	.22	.00	308.
1.01	7.30	90	.01	.01	.01	10.	1.01	20.00	240	.22	.22	.00	308.
1.01	7.35	91	.01	.01	.01	10.	1.01	20.05	241	.22	.22	.00	308.
1.01	7.40	92	.01	.01	.01	10.	1.01	20.10	242	.22	.22	.00	308.
1.01	7.45	93	.01	.01	.01	10.	1.01	20.15	243	.22	.22	.00	308.
1.01	7.50	94	.01	.01	.01	10.	1.01	20.20	244	.22	.22	.00	308.
1.01	7.55	95	.01	.01	.01	10.	1.01	20.25	245	.22	.22	.00	308.
1.01	8.00	96	.01	.01	.01	10.	1.01	20.30	246	.22	.22	.00	308.
1.01	8.05	97	.01	.01	.01	10.	1.01	20.35	247	.22	.22	.00	308.
1.01	8.10	98	.01	.01	.01	10.	1.01	20.40	248	.22	.22	.00	308.
1.01	8.15	99	.01	.01	.01	10.	1.01	20.45	249	.22	.22	.00	308.
1.01	8.20	100	.01	.01	.01	10.	1.01	20.50	250	.22	.22	.00	308.
1.01	8.25	101	.01	.01	.01	10.	1.01	20.55	251	.22	.22	.00	308.
1.01	8.30	102	.01	.01	.01	10.	1.01	21.00	252	.22	.22	.00	308.
1.01	8.35	103	.01	.01	.01	10.	1.01	21.05	253	.22	.22	.00	308.
1.01	8.40	104	.01	.01	.01	10.	1.01	21.10	254	.22	.22	.00	308.
1.01	8.45	105	.01	.01	.01	10.	1.01	21.15	255	.22	.22	.00	308.
1.01	8.50	106	.01	.01	.01	10.	1.01	21.20	256	.22	.22	.00	308.
1.01	8.55	107	.01	.01	.01	10.	1.01	21.25	257	.22	.22	.00	308.
1.01	9.00	108	.01	.01	.01	10.	1.01	21.30	258	.22	.22	.00	308.
1.01	9.05	109	.01	.01	.01	10.	1.01	21.35	259	.22	.22	.00	308.
1.01	9.10	110	.01	.01	.01	10.	1.01	21.40	260	.22	.22	.00	308.
1.01	9.15	111	.01	.01	.01	10.	1.01	21.45	261	.22	.22	.00	308.
1.01	9.20	112	.01	.01	.01	10.	1.01	21.50	262	.22	.22	.00	308.
1.01	9.25	113	.01	.01	.01	10.	1.01	21.55	263	.22	.22	.00	308.
1.01	9.30	114	.01	.01	.01	10.	1.01	22.00	264	.22	.22	.00	308.
1.01	9.35	115	.01	.01	.01	10.	1.01	22.05	265	.22	.22	.00	308.

13

TIME	1-HOUR	5-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME
1.01	9.48	116	137	156	265
1.02	9.45	117	137	156	267
1.03	9.53	118	138	157	269
1.04	9.58	119	139	158	270
1.05	10.03	120	140	159	271
1.06	10.05	121	141	160	272
1.07	10.10	122	142	161	273
1.08	10.15	123	143	162	274
1.09	10.20	124	144	163	275
1.10	10.25	125	145	164	276
1.11	10.30	126	146	165	277
1.12	10.35	127	147	166	278
1.13	10.40	128	148	167	279
1.14	10.45	129	149	168	280
1.15	10.50	130	150	169	281
1.16	10.55	131	151	170	282
1.17	11.00	132	152	171	283
1.18	11.05	133	153	172	284
1.19	11.10	134	154	173	285
1.20	11.15	135	155	174	286
1.21	11.20	136	156	175	287
1.22	11.25	137	157	176	288
1.23	11.30	138	158	177	289
1.24	11.35	139	159	178	290
1.25	11.40	140	160	179	291
1.26	11.45	141	161	180	292
1.27	11.50	142	162	181	293
1.28	11.55	143	163	182	294
1.29	12.00	144	164	183	295
1.30	12.05	145	165	184	296
1.31	12.10	146	166	185	297
1.32	12.15	147	167	186	298
1.33	12.20	148	168	187	299
1.34	12.25	149	169	188	300
1.35	12.30	150	170	189	301
1.36	12.35	151	171	190	302
1.37	12.40	152	172	191	303
1.38	12.45	153	173	192	304
1.39	12.50	154	174	193	305
1.40	12.55	155	175	194	306
1.41	13.00	156	176	195	307
1.42	13.05	157	177	196	308
1.43	13.10	158	178	197	309
1.44	13.15	159	179	198	310
1.45	13.20	160	180	199	311
1.46	13.25	161	181	200	312
1.47	13.30	162	182	201	313
1.48	13.35	163	183	202	314
1.49	13.40	164	184	203	315
1.50	13.45	165	185	204	316
1.51	13.50	166	186	205	317
1.52	13.55	167	187	206	318
1.53	14.00	168	188	207	319
1.54	14.05	169	189	208	320
1.55	14.10	170	190	209	321
1.56	14.15	171	191	210	322
1.57	14.20	172	192	211	323
1.58	14.25	173	193	212	324
1.59	14.30	174	194	213	325
1.60	14.35	175	195	214	326
1.61	14.40	176	196	215	327
1.62	14.45	177	197	216	328
1.63	14.50	178	198	217	329
1.64	14.55	179	199	218	330
1.65	15.00	180	200	219	331
1.66	15.05	181	201	220	332
1.67	15.10	182	202	221	333
1.68	15.15	183	203	222	334
1.69	15.20	184	204	223	335
1.70	15.25	185	205	224	336
1.71	15.30	186	206	225	337
1.72	15.35	187	207	226	338
1.73	15.40	188	208	227	339
1.74	15.45	189	209	228	340
1.75	15.50	190	210	229	341
1.76	15.55	191	211	230	342
1.77	16.00	192	212	231	343
1.78	16.05	193	213	232	344
1.79	16.10	194	214	233	345
1.80	16.15	195	215	234	346
1.81	16.20	196	216	235	347
1.82	16.25	197	217	236	348
1.83	16.30	198	218	237	349
1.84	16.35	199	219	238	350
1.85	16.40	200	220	239	351
1.86	16.45	201	221	240	352
1.87	16.50	202	222	241	353
1.88	16.55	203	223	242	354
1.89	17.00	204	224	243	355
1.90	17.05	205	225	244	356
1.91	17.10	206	226	245	357
1.92	17.15	207	227	246	358
1.93	17.20	208	228	247	359
1.94	17.25	209	229	248	360
1.95	17.30	210	230	249	361
1.96	17.35	211	231	250	362
1.97	17.40	212	232	251	363
1.98	17.45	213	233	252	364
1.99	17.50	214	234	253	365
2.00	17.55	215	235	254	366
2.01	18.00	216	236	255	367
2.02	18.05	217	237	256	368
2.03	18.10	218	238	257	369
2.04	18.15	219	239	258	370
2.05	18.20	220	240	259	371
2.06	18.25	221	241	260	372
2.07	18.30	222	242	261	373
2.08	18.35	223	243	262	374
2.09	18.40	224	244	263	375
2.10	18.45	225	245	264	376
2.11	18.50	226	246	265	377
2.12	18.55	227	247	266	378
2.13	19.00	228	248	267	379
2.14	19.05	229	249	268	380
2.15	19.10	230	250	269	381
2.16	19.15	231	251	270	382
2.17	19.20	232	252	271	383
2.18	19.25	233	253	272	384
2.19	19.30	234	254	273	385
2.20	19.35	235	255	274	386
2.21	19.40	236	256	275	387
2.22	19.45	237	257	276	388
2.23	19.50	238	258	277	389
2.24	19.55	239	259	278	390
2.25	20.00	240	260	279	391
2.26	20.05	241	261	280	392
2.27	20.10	242	262	281	393
2.28	20.15	243	263	282	394
2.29	20.20	244	264	283	395
2.30	20.25	245	265	284	396
2.31	20.30	246	266	285	397
2.32	20.35	247	267	286	398
2.33	20.40	248	268	287	399
2.34	20.45	249	269	288	400
2.35	20.50	250	270	289	401
2.36	20.55	251	271	290	402
2.37	21.00	252	272	291	403
2.38	21.05	253	273	292	404
2.39	21.10	254	274	293	405
2.40	21.15	255	275	294	406
2.41	21.20	256	276	295	407
2.42	21.25	257	277	296	408
2.43	21.30	258	278	297	409
2.44	21.35	259	279	298	410
2.45	21.40	260	280	299	411
2.46	21.45	261	281	300	412
2.47	21.50	262	282	301	413
2.48	21.55	263	283	302	414
2.49	22.00	264	284	303	415
2.50	22.05	265	285	304	416
2.51	22.10	266	286	305	417
2.52	22.15	267	287	306	418
2.53	22.20	268	288	307	419
2.54	22.25	269	289	308	420
2.55	22.30	270	290	309	421
2.56	22.35	271	291	310	422
2.57	22.40	272	292	311	423
2.58	22.45	273	293	312	424
2.59	22.50	274	294	313	425
2.60	22.55	275	295	314	426
2.61	23.00	276	296	315	427
2.62	23.05	277	297	316	428
2.63	23.10	278	298	317	429
2.64	23.15	279	299	318	430
2.65	23.20	280	300	319	431
2.66	23.25	281	301	320	432
2.67	23.30	282	302	321	433
2.68	23.35	283	303	322	434
2.69	23.40	284	304	323	435
2.70	23.45	285	305	324	436
2.71	23.50	286	306	325	437
2.72	23.55	287	307	326	438
2.73	24.00	288	308	327	439
2.74	24.05	289	309	328	440
2.75	24.10	290	310	329	441
2.76	24.15	291	311	330	442
2.77	24.20	292	312	331	443
2.78	24.25	293	313	332	444
2.79	24.30	294	314	333	445
2.80	24.35	295	315	334	446
2.81	24.40	296	316	335	447
2.82	24.45	297	317	336	448
2.83	24.50	298	318	337	449
2.84	24.55	299	319	338	450
2.85	25.00	300	320	339	451
2.86	25.05	301	321	340	452
2.87	25.10	302	322	341	453
2.88	25.15	303	323	342	454
2.89	25.20	304	324	343	455
2.90	25.25	305	325	344	456
2.91	25.30	306	326	345	457
2.92	25.35	307	327	346	458
2.93	25.40	308	328	347	459
2.94	25.45	309	329	348	460
2.95	25.50	310	330	349	461
2.96	25.55	311	331	350	462
2.97	26.00	312	332	351	463
2.98	26.05	313	333	352	464
2.99	26.10	314	334	353	465
3.00	26.15	315	335	354	466
3.01	26.20	316	336	355	467
3.02	26.25	317	337	356	468
3.03	26.30	318	338	357	469
3.04	26.35	319	339	358	470
3.05	26.40	320	340	359	471
3.06	26.45	321	341	360	472
3.07	26.50	322	342	361	473
3.08	26.55	323	343	362	474
3.09	27.00	324	344	363	475
3.10	27.05	325	345	364	476
3.11	27.10	326	346	365	477
3.12	27.15	327	347	366	478
3.13	27.20	328	348	367	479
3.14	27.25	329	349	368	480
3.15	27.30	330	350	369	481
3.16	27.35	331	351	370	482
3.17	27.40	332	352	371	483
3.18	27.45	333	353	372	484
3.19	27.50	334	354	373	485
3.20	27.55	335	355	374	486
3.21	28.00	336	356	375	487
3.22	28.05	337	357	376	488
3.23	28.10	338	358	377	489
3.24					



HYDROCKAPH AT STA 19387 FCK PLAN 10 RTIO 2

HYDROGRAPH AT STA 19387 FOR PLAN 1, RYIO 2									
0.	0.	0.	0.	0.	0.	0.	0.	0.	0.
0.	0.	0.	0.	0.	0.	0.	0.	0.	0.
0.	0.	0.	0.	0.	0.	0.	0.	0.	0.
0.	0.	0.	0.	0.	0.	0.	0.	0.	0.
1.	1.	1.	1.	1.	1.	1.	1.	1.	1.
2.	2.	2.	2.	2.	2.	2.	2.	2.	2.
3.	3.	3.	3.	3.	3.	3.	3.	3.	3.
4.	4.	4.	4.	4.	4.	4.	4.	4.	4.
5.	5.	5.	5.	5.	5.	5.	5.	5.	5.
6.	6.	6.	6.	6.	6.	6.	6.	6.	6.
7.	7.	7.	7.	7.	7.	7.	7.	7.	7.
8.	8.	8.	8.	8.	8.	8.	8.	8.	8.
9.	9.	9.	9.	9.	9.	9.	9.	9.	9.
10.	10.	10.	10.	10.	10.	10.	10.	10.	10.
11.	11.	11.	11.	11.	11.	11.	11.	11.	11.
12.	12.	12.	12.	12.	12.	12.	12.	12.	12.
13.	13.	13.	13.	13.	13.	13.	13.	13.	13.
14.	14.	14.	14.	14.	14.	14.	14.	14.	14.
15.	15.	15.	15.	15.	15.	15.	15.	15.	15.
16.	16.	16.	16.	16.	16.	16.	16.	16.	16.
17.	17.	17.	17.	17.	17.	17.	17.	17.	17.
18.	18.	18.	18.	18.	18.	18.	18.	18.	18.
19.	19.	19.	19.	19.	19.	19.	19.	19.	19.
20.	20.	20.	20.	20.	20.	20.	20.	20.	20.
21.	21.	21.	21.	21.	21.	21.	21.	21.	21.
22.	22.	22.	22.	22.	22.	22.	22.	22.	22.
23.	23.	23.	23.	23.	23.	23.	23.	23.	23.
24.	24.	24.	24.	24.	24.	24.	24.	24.	24.
25.	25.	25.	25.	25.	25.	25.	25.	25.	25.
26.	26.	26.	26.	26.	26.	26.	26.	26.	26.
27.	27.	27.	27.	27.	27.	27.	27.	27.	27.
28.	28.	28.	28.	28.	28.	28.	28.	28.	28.
29.	29.	29.	29.	29.	29.	29.	29.	29.	29.
30.	30.	30.	30.	30.	30.	30.	30.	30.	30.
31.	31.	31.	31.	31.	31.	31.	31.	31.	31.
32.	32.	32.	32.	32.	32.	32.	32.	32.	32.
33.	33.	33.	33.	33.	33.	33.	33.	33.	33.
34.	34.	34.	34.	34.	34.	34.	34.	34.	34.
35.	35.	35.	35.	35.	35.	35.	35.	35.	35.
36.	36.	36.	36.	36.	36.	36.	36.	36.	36.
37.	37.	37.	37.	37.	37.	37.	37.	37.	37.
38.	38.	38.	38.	38.	38.	38.	38.	38.	38.
39.	39.	39.	39.	39.	39.	39.	39.	39.	39.
40.	40.	40.	40.	40.	40.	40.	40.	40.	40.
41.	41.	41.	41.	41.	41.	41.	41.	41.	41.
42.	42.	42.	42.	42.	42.	42.	42.	42.	42.
43.	43.	43.	43.	43.	43.	43.	43.	43.	43.
44.	44.	44.	44.	44.	44.	44.	44.	44.	44.
45.	45.	45.	45.	45.	45.	45.	45.	45.	45.
46.	46.	46.	46.	46.	46.	46.	46.	46.	46.
47.	47.	47.	47.	47.	47.	47.	47.	47.	47.
48.	48.	48.	48.	48.	48.	48.	48.	48.	48.
49.	49.	49.	49.	49.	49.	49.	49.	49.	49.
50.	50.	50.	50.	50.	50.	50.	50.	50.	50.



**THE**

# AGOUTE HYDROGRAPH THROUGH NEV CAMERIA LAKE DAM:

DATE	DESCRIPTION	AMOUNT	BALANCE
1960-01-01	OPENING BALANCE	740.00	740.00
1960-01-15	PAYROLL	747.00	750.00
1960-01-31	CLOSING BALANCE	750.00	750.00

[illegible][illegible][illegible]

DAY DATA  
2008 FURN BASHYD

100

END-OF-PERIOD HYDROGRAPH ORDINATES

09-10-1960

100

100

189 190 210 230 240 250 260 270 280 290 300 310 320 330 340 350 360 370 380 390 400 410 420 430 440 450 460 470 480 490 500 510 520 530 540 550 560 570 580 590 600 610 620 630 640 650 660 670 680 690 700 710 720 730 740 750 760 770 780 790 800 810 820 830 840 850 860 870 880 890 900 910 920 930 940 950 960 970 980 990 1000

1

SUMMARY OF PMF AND ONE-HALF PMF FLOOD ROUTING

PEAK FLOW AND STORAGE (END OF PERIOD) SUMMARY FOR MULTIPLE PLAN-RATIO ECONOMIC COMPUTATIONS  
 FLOWS IN CUBIC FEET PER SECOND (CUBIC METERS PER SECOND)  
 AREA IN SQUARE MILES (SQUARE KILOMETERS)

RATIOS APPLIED TO FLOWS

OPERATION	STATION	AREA	PLAN	RATIO 1	RATIO 2
				1.00	.50
HYDROGRAPH AT	16387	.10	1	2403	1201
		.97	1	54.043	34.023
SCURED TO	16387	.10	1	1951	785
		.97	1	55.531	22.24



PERCENT OF PMF FLOOD ROUTING  
EQUAL TO SPILLWAY CAPACITY

PREVIEW OF SEQUENCE OF STREAM NETWORK CALCULATIONS

RUNOFF HYDROGRAPH AT 10187  
ROUTE HYDROGRAPH TO 10387  
END OF NETWORK

DATE: 79/09/21  
TIME: 09.28.38.

DAM SAFETY INSPECTION - MISSOURI  
NEW CAMBRIA LAKE DAM (MO-10387)  
PERCERY DMF

JOB SPECIFICATION									
NO	NHR	NHIV	JDAY	IHR	IMIN	METNC	IPLT	IPAT	INSTAN
100	0	0	3	3	0	0	0	4	0
JOPER				NUT	LAOPT	TRACE			
				0	0	0			

```

MULTI-PLAY ANALYSES TO BE PERFORMED
      .030 .031 .032 .033 .034
      NPLANE= 1 NRTIO= 5 LRTIO= 1
      RTIOS=

```

```
*****  
SUB-AREA RUNOFF COMPUTATION  
*****
```

### INPUT PRECIPITATION VALUES, RATIOS AND UNIT HYDROGRAPH PARAMETERS

IWDG	2	IUNG		TAREA	SNAF	HYDROGRAPH DATA	RATIO	ISNCH	ISAME	LOCAL	ISTAGE	IAUTO
1	2			.18	0.66	INSDA .18	1.00					
						IECON		JPLI	JPTT	IVANE		
						ICOMP						
						ISTAG	1957					

PRECIP DATA									
	SPFC	PMS	R6	R12	R24	R48	R72	R96	
	8.00	24.20	100.50	120.00	130.00	0.00	0.00	0.00	
LOSS DATA									
	LRBY	STNR	DLTR	RTOL	ERAIN	STKRS	ATYOK	STRTL	CNSTL
	0.00	0.00	0.00	1.00	0.00	0.00	1.00	-1.00	-87.00
									ALSKN
									0.00
									RTIMP
									0.00
CURVE NO = 87.00 WEINSS = 1.00 EFFECT CN = 87.00									

UNIT HYDROGRAPH DATA  
TCZ -0030 . LAGZ. 008 .

```

STATE= 0.00 RESECTION DATA 0.00 RTIONS 3.00

```

[illegible]

SUM 31.46 29.74 1.72 43.20  
 ( 799.41 755.36 44.05 117.40)

HYDROGRAPH ROUTING

ROUTE HYDROGRAPH THROUGH NEW CAMBRIA LAKE DAM

ISFQ	ICOMP	1	ICON	ITAPE	JPLT	JPRF	IMAF	ISTAGE	TAUTO
1387									
ROUTING DATA									
IRIN	ISANE	IOPT	IPMP	LSTR					
2	1	0	0	0					
LAG ANSAK X TSK STORA ISPRAT									
0	0	0	0.000	0.000	0.000	0.000	-740	-1	
STAGE	740.00	741.50	743.00	744.00	747.00	750.00			
FLOW	0.00	62.00	229.00	544.00	747.00	1868.00			
CAPACITY	0.00	40.00	70.00	390.00	1302.00	2714.00			
ELEVATION	723.00	740.00	740.00	740.00	750.00	800.00			
DAM DATA									
TOPEL	COOD	EXPV	ELEV	COOL	CARCA	EXPL			
703.6	0.00	0.00	0.00	0.00	0.00	0.00			

PEAK OUTFLOW IS 225. AT TIME 15.92 HOURS

PEAK OUTFLOW IS 244. AT TIME 15.92 HOURS

PEAK OUTFLOW IS 269. AT TIME 15.92 HOURS

PEAK OUTFLOW IS 292. AT TIME 15.92 HOURS

PEAK OUTFLOW IS 313. AT TIME 15.95 HOURS



PEAK FLOW AND STORAGE (END OF PERIOD) SUMMARY FOR MULTIPLE PLAN-RATIO ECONOMIC COMPUTATIONS  
 FLOWS IN CUBIC FEET PER SECOND (CUBIC METERS PER SECOND)  
 AREA IN SQUARE MILES (SQUARE KILOMETERS)

OPERATION	STATION	AREA	PLAN	RATIO 1	RATIO 2	RATIOS APPLIED TO FLOWS			
						RATIO 3	RATIO 4	RATIO 5	
HYDROGRAPH AT	10397	.18	1	721.	745.	769.	793.	817.	
		.97		20.91	21.64	21.77	22.45	23.13	
ROUTED TO	10387	.18	1	235.	244.	269.	292.	313.	
		.97		6.39	6.41	7.63	8.29	8.81	

# PLAN I

RATIO OF PMF	MINIMUM RESERVOIR W.S.-ELEV.	MAXIMUM DEPTH OVER DAM	MAXIMUM STORAGE AC-FT.	MAXIMUM THWFLOW CFS	DURATION OVER TOP HOURS	TIME OF MAX OUTFLOW HOURS	TIME OF FAILURE HOURS
.38	743.55	0.00	70.	225.	0.38	15.92	0.00
.31	743.62	.02	70.	246.	.25	15.92	0.00
.32	743.55	.75	71.	269.	.33	15.92	0.00
.33	743.69	.08	72.	292.	.50	15.92	0.00
.34	743.71	.11	72.	313.	.50	15.93	0.00